# MANUAL OF SCALING INSTRUCTIONS

FOURTH EDITION January 2023



## **Table of Contents**

I. Introduction	1
II. Principles of Scaling	1
Limits of a Scale	1
III. Training and Licensing Requirements	2
Courses	
Types of Licences	2
Examination	
Maintenance of a Valid Licence	
Responsibilities	
Refusal to Scale	3
IV. Equipment	4
V. Scaling Information	6
Check Scaling	6
Rescale	7
Company Scalers Measuring For Manitoba	
Principles of Rounding	8
VI. Methods of Wood Measurement	9
Cubic Method	9
Diameter Measurement	
Length Measurement	
Cubic Method One - Measuring Small End	
Cubic Method Two - Measuring Both Ends	
Butt Swell	
Deductions in Cube Scaling	15
Stacked Wood Method	16
Measuring Procedure	
Length	
Height	
Width	
Calculation of Volume	
Deductions for Stack Scaling	
Conversion Factors for Rough or Peeled Bolts	
Rough Wood Factor	
Peeled Wood Factor	
Conversion Factors for Stacks	
Mass Scaling Method	24
Mass Scaling Measuring Procedure	
Calculation of Volume	
Applying Factors to Determine Volume	26
	27

Sample Scaling Method	28
Application of Sample Scaling	
Design of a Sample Survey	
Piece and Linear Scaling Method	
Deductions for Cull, Undersize, Defect and Void	30
Cull	
Undersize	
Defect	
Full Length Heart Rot	
Half Length Defect	
Butt Length Defect	
Butt End Defect Greater Than 75% of Butt End	
Punk Rot.	
Long Narrow Defects	
Heart Check	
Defects Separated by 14 Centimetres or less	
Defects Separated by More Than 14 Centimetre	
Sap Rot Defect	
Pipe and Pocket Rot	
Dead Side or Seam Defect or Rot	40
Church Door or Catface	41
Crotch or Forked Top	41
Void	42
VII. Infractions and Wasteful Practices	46
Infractions	46
Wasteful Practices	46
Leaving High Stumps	46
Leaving Merchantable Timber of Any Length	46
Not Utilizing Wood Chip Fibre	49
Assessment of Penalties	50
Unauthorized Harvesting	
Unauthorized Hauling of Crown Forest Resources	50
VIII. Movement and Measurement of Crown Forest Resources	50
Scaling Plans	
Movement of Unscaled Crown Forest Resources	
Load Slip.	
-	
IX. Sampling for Factors	51
X. Information Collection and Management	52
Data Collectors	52
Tally Sheets, Forms and Records	52
Electronic Data Transfer	52
Glossary of Terms	54
References	55
=	

### **List of Tables**

Table 1	Table of Squared Numbers	56
Table 2	Area of a Circle in Square Metres (m <sup>2</sup> )	57
Table 3	Log Volume in Cubic Metres of Cylinders	58
Table 4	Log Volume in Cubic Metres of Tapering Cylinders	62
Table 5	Factors for Metric Conversion	66

## **List of Figures**

Figure 1	Scaling sticks	. 5
Figure 2	Measuring diameters: logs with regular sawn surfaces	10
Figure 3	Measuring diameters: logs with irregular sawn surfaces	11
Figure 4	Length measurement	12
Figure 5	Length class determination 2 cm class	12
Figure 6	Length class determination 20 cm class	13
Figure 7	Butt Swell	15
Figure 8	Stacked cubic metre	16
Figure 9	Measuring length of stack when stack drops off at both ends	17
Figure 10	Measuring length of stack on a slope	17
Figure 11	Measuring height of stack	18
Figure 12	Measuring stack height using exterior tangents	19
Figure 13	Height measurements taken on a loaded truck	19
Figure 14	Measuring height of stack piled on a slope	20
Figure 15	Stacked wood	21
Figure 16	Stack identification	22
Figure 17	Cull logs	30
Figure 18	Heart rot	33
Figure 19	Full length heart rot	33
Figure 20	Butt rot	34
Figure 21	Butt rot	35
Figure 22	Punk rot	36
Figure 23	Long narrow defect	37
Figure 24	Heart check on the end surface of a log	37
Figure 25	Two defects separated by 14 cm or less	38
Figure 26	Sap rot	39
Figure 27	Pipe and pocket rot	40
Figure 28	Dead side or seam defect or rot	40
Figure 29	Crotch or forked top	41
Figure 30	Net pile volume	44
Figure 31	Stump height	46
Figure 32	Merchantable softwood timber	47
Figure 33	Softwood timber with unmerchantable section	47
Figure 34	Merchantable hard wood timber	47
Figure 35	Unmerchantable sections	48
Figure 36	Timber with unmerchantable sections	48
Figure 37	Un-utilized wood chip fibre	49

Appendices	. 67
Appendix 1 Log Identification	. 67
Appendix 2 Principal Commercial Species: Identification and Symbols	. 69
Appendix 3 Summary of Formulae	. 70
Appendix 4 Answers to Exercises	. 72
Appendix 5 Manitoba NRND Scaling Plan	. 73
Appendix 6 Manitoba NRND Crown Land Load Slip	. 74
Appendix 7 Manitoba NRND Private Land Load Slip	. 75
Appendix 8 Application for Scaler's Licence in Manitoba	. 76
Appendix 9 Mass/Volume Sampling Tally Sheet	. 77
Appendix 10 Undersize and Defect Sampling Procedures	. 78
Appendix 11 Chipperwood Sampling Procedures	. 80
Appendix 12 Post and Rail Sampling Procedures	. 83

#### I. Introduction

This manual summarizes the procedures and instructions for scaling or measuring Crown timber in metric units as approved by the Director of Forestry, Manitoba Natural Resources and Northern Development.

The basis for the scaling or measuring instructions in metric units for this manual is the Canadian Standards Association standards entitled CSA 0302.1-15/0302.2-15 Scaling Roundwood/Measurement of Woodchips, Tree Residues and Byproducts.

The scaling manual is authorized under The Forest Act and Forest Use and Management Regulation.

### II. Principles of Scaling

Scaling is measuring or estimating quantity, expressed as the volume, area, length, mass or number of products obtained from trees after they are felled.

A scaler is a person qualified to scale primary forest products and is usually licensed or appointed by a government agency. No person shall scale Crown timber for the purpose of preparing a monthly timber return or monthly timber report unless he or she holds a valid scaler's licence issued by the Forestry Branch director.

The scaling of Crown forest resources is the measurement of harvested Crown forest resources and the determination of defects that affect their use. There are several methods of scaling which may be approved for use in Manitoba. They are: solid volume of individual logs, stacked volume, mass scaling, sample scaling and piece and linear scaling. Other methods of scaling may be allowed in exceptional circumstances.

#### **Limits of a Scale**

Wood, when scaled by the instructions set out in this manual and without modification, is scaled for usable volume only, without regard for grade, product, or market conditions. Furthermore, wood is recognized as difficult material to measure accurately because every tree, log or bolt has a different size and shape. Wood that is transported, re-piled or further processed will often yield a different scale volume.

Scaling is used to determine wood volumes for:

- crown dues
- wage payments
- inventory control
- statistical data
- commercial transactions
- research and development

Scalers must measure Crown forest resources according to the instructions in this manual. They must be able to identify species, recognize defects and make only such deductions as authorized in this manual. Scalers must provide true and accurate information and must not vary from the prescribed methods of measurement.

All sound or merchantable Crown forest resources, regardless of size or species must be measured and recorded. Only deductions defined by this manual will be shown on scale records returned to Natural Resources and Northern Development (NRND).

Wood piled for scaling must be sufficiently separated when different dues rates, cutting authorities, scaling procedures and dates are applicable.

The cubic metre (m³) is the recognized unit of timber measurement in Manitoba. However, a cubic metre of timber does not always yield a consistent volume of manufactured product. This may be due to different machinery, manufacturing processes or skill of operating personnel. Variations are to be expected and the scaler must not alter scaling practices to adjust for them.

### III. Training and Licensing Requirements

#### **Courses**

Candidates for a scaler's licence must successfully complete a course of study and pass examinations approved by NRND. Courses are held under the direction of the Director of Forestry in various locations in the province.

### **Types of Licences**

Two types of scaling licences are issued by the province of Manitoba. They are the Manitoba Scalers Licence and the Interim Scalers Licence. An application for a scaler's licence must be made in writing to the director on a form approved by or acceptable to the director and must be accompanied by the appropriate fee. A scaler's licence is subject to any terms and conditions imposed upon it.

#### 1. Manitoba Scalers Licence

A scaler's licence may only be issued for a period of five years to a person who:

- has successfully completed Manitoba's scaling licence certificate course with an overall mark of 65% or greater and achieve a minimum of 50% on both the field and written tests to satisfy the director that he or she is proficient in scaling
- holds a valid scaling licence or permit from another province or territory.

#### 2. Interim Scalers Licence

An Interim scaler's licence may be issued for a period not exceeding one year, generally under the supervision of a licensed scaler and may be limited in product or scope at the discretion of the Director of Forestry. In most cases the individual will be required to successfully complete the Interim Scaling Licence Eligibility Test before being granted an interim licence.

An Interim scaler's licence may be issued to applicants who:

- achieve an overall mark between 50% and 64% on the provincial scaling licence certificate course and are recommended for this licence
- are seeking a Manitoba Scaler's licence with acceptable supporting documents and recommendations as to his/her abilities in scaling

#### Examination

The Director of Forestry determines the standard and method of examination. Scalers will be required to pass field and written tests. The Director of Forestry will determine the fees for the training course and examination fees to be paid by candidates.

#### Maintenance of a Valid Licence

It is the responsibility of the scaler to renew his/her licence. A scalers licence may be cancelled by the Director of Forestry if a scaler:

- does not attend and/or successfully complete a full or refresher scaling course within a specified time frame as set by NRND
- consistently obtains results which, when compared to check scales, are outside of the allowed limits
- conducts himself/herself in a manner, with regard to scaling, which the Director of Forestry deems unfit

#### Responsibilities

A scaler engaged to scale Crown Timber must:

- have a current scaling licence
- scale all Crown timber according to the authorized scaling manual
- know the authority under which a timber cutting operation is carried out
- know the conditions of the timber operation, such as tree species, classes and size
  of timber to be cut and how timber is to be measured and recorded
- report illegal or wasteful practices to the employing agency whenever these practices are found
- understand the particulars of scaling which may be detailed in any agreement between his employer and NRND
- take care of all equipment, forms and stationery
- submit all records and reports accurately and on time

#### Refusal to Scale

A scaler may refuse to scale wood where:

- the wood is piled in such a configuration that a scale may not be conducted in a satisfactory manner
- in the undertaking of a scale, the scaler, will be placed in an unsafe or hazardous situation
- on request by the scaler, the party requesting the scale is unable to supply acceptable documentation as to the ownership or legality of the wood in question

Where the refusal to scale is unacceptable to the requesting party, the decision of the Director of Forestry, or their appointed representative, as to scaling the wood or not, is final.

## IV. Equipment

Approved scaling equipment should meet the specifications as set out in:

• C.S.A. standard entitled *Scaling Roundwood/Measurement of Woodchips, Tree Residues and Byproducts* CSA 0302.1-15/0302.2-15

Equipment used in scaling should be checked for calibration at least once every six months.

There are three official scaling sticks used for measuring Crown forest resources (Figure 1).

- 1. The **scaling stick marked MC-1** is used for measuring timber in cubic metres. This stick is graduated in even two centimetre classes with the class boundary occurring on the odd centimetre. The MC-1 shows volumes of 2.54 metre timber in **stacked cubic metres** for each diameter class. In addition, this stick shows diameter reductions for defective logs in each diameter class. For example, an 8 cm defect on a 20 cm diameter log reduces the effective diameter of the log by 2cm.
- 2. The **scaling stick marked MC-2** is used for measuring large diameter timber in cubic metres. It is graduated in even two centimetre classes with the class boundary occurring on the odd centimetre. The MC-2 shows volumes of 2.54 metre timber in **stacked cubic metres** for each diameter class. It also shows diameter reductions for defective logs in each diameter class.
- 3. The **stacked wood scaling stick** is used for measuring wood in **stacked cubic metres**. This stick is graduated in even two centimetre classes with the class boundary occurring on the odd centimetre. It is 1.5 metres long and extends to a length of 3 metres. The reverse side of the stick is used to measure log lengths in 20 cm classes with the class boundary occurring on the even centimetre (e.g. 1.0 m, 1.2 m). Log lengths are recorded in the odd centimetre class (e.g. 1.1 m, 1.3 m).

Metric tape measures may also be used to determine the length of stacked piles or individual logs lengths. The use of other equipment requires the prior approval of the Director of Forestry.

When marking timber that has been scaled, the colour blue is reserved for Crown purposes. No operator, individual or scaler who is not authorized or employed to measure timber for NRND may use this colour. Other colours are available to use for non Crown purposes.

Red is requested for use in special scaling cases such as check, audit or rescale purposes, or for special studies, but is not restricted to use by NRND.



Figure 1 Scaling sticks

## V. Scaling Information

#### **Check Scaling**

A check scale is used as a standard for comparing the work of other scalers for the purpose of maintaining a uniform level of performance and providing a control over human error associated with scaling. The check scaler is an appointed scaler who has demonstrated his or her ability, obtained through experience, to consistently scale accurately.

#### Check scaling:

- ensures that the determination of volume and stumpage values is accurate
- maintains uniform scaling practices throughout the province
- ensures compliance with the scaling manual
- provides opportunities for continuing instruction to scalers on actual operations
- provides opportunities for checking new scalers
- provides opportunities for checking interim licensed scalers

Check scaling must take place at the location where the timber was originally measured, using the same scaling method, with the timber in the same form and manner of aggregation in which the original scale was made.

## The allowable maximum relative scaling error is $\pm$ 3 per cent of the official check scale.

If a check scale indicates the scaler is outside the allowable margin of error, NRND may request the scaler be removed from scaling duties pending a satisfactory resolution of the situation.

When cubed wood is check scaled, average diameters, lengths and cull and defect volumes will be recorded.

When stacked wood is check scaled, the measurements (height, length and width of stack), volumes of undersize, cull, defect and voids of each stack will be recorded.

Check scale reports must be reviewed and retained by NRND.

#### Rescale

To settle a dispute between NRND and a company involving the measurement of Crown forest resources, a rescale may be required. The measurement of the disputed Crown forest resources must:

- be conducted by NRND's licensed scalers
- take place at the location where the wood was originally measured
- be measured using the same scaling method as the original scale
- be in the form in which it was originally scaled

Adjustments to volumes, if necessary, will be made on the disputed Crown forest resources. The cost of measuring previously scaled volumes to resolve a dispute may be assessed against the company if the volume of the re-measurement is within  $\pm$  3% of the volume initially determined by NRND.

The Director of Forestry is the sole arbiter in disputes concerning Crown forest resources.

NRND will not enter into, nor arbitrate scaling disputes:

- between a company and a union
- between companies
- between companies and contractors
- in any other situation where scaling is not done for NRND purposes

## **Company Scalers Measuring For Manitoba Natural Resources and Northern Development Purposes**

The Minister of Natural Resources and Northern Development may authorize the measurement of Crown forest resources, for NRND purposes, by approved scalers employed by companies. They will scale and make returns in accordance with the scaling manual.

All Crown forest resources measured by company scalers are subject to NRND check scales. At the request of an authorized NRND official, all scaling records (ex: tally sheets, check scales, summaries, invoices, statements of accounts) of Crown forest resources measured are to be made available for inspection at reasonable times. Copies of all NRND check scales will be made available to the company concerned.

Company scalers, measuring for NRND purposes, must measure and record all merchantable material of any species used for fuelwood, skids, camps, bridges, corduroy or any construction work on forest operations.

Company scalers may <u>assist</u>, with the written approval of NRND, in sampling Crown forest resources to:

- establish mass/volume ratios
- determine cull, defect and undersize factors
- determine product distribution factors
- gather statistical information for NRND purposes

Measuring and recording for the above purposes must be done in accordance with the instructions in the scaling manual.

#### **Principles of Rounding**

The following principles of rounding will apply in wood measurement; for example, when rounding to two decimal places:

- If the last digit is less than five, the second digit to the right of the decimal place remains the same. Ex: 3.234 = 3.23
- If the last digit is greater than five, the second digit to the right of the decimal place is raised to the next highest digit. Ex: 3.236 = 3.24
- If the last digit is five, preceded by an even number, the second digit to the right of the decimal place remains the same. Ex: 3.245 = 3.24
- If the last digit is five, preceded by an odd number, the second digit to the right of the decimal place is raised to the next highest digit. Ex: 3.255 = 3.26
- These principles also apply when rounding to three or more decimal places.

Round the following to two decimal places	Principles of Rounding Exercise:	(answers in appendix 4)
	Round the following to two decim	nal places

8.377 = 8.374 = 8.375 = 8.365 =	
2.436 = 2.479 = 2.123 = 2.315 =	
5.225 = 5.528 = 5.235 = 5.155 =	

#### VI. Methods of Wood Measurement

All softwoods and hardwoods of any length may be measured by this method. *Unit* of measurement = solid cubic metre =  $m^3$ .

#### **Cubic Method**

There are two scaling systems which may be used to obtain the net volume of solid wood in an individual log in m<sup>3</sup>:

- 1. measuring the small end diameter and the length of a log (Cubic Method One, see page 13)
- 2. measuring both end diameters and the length of a log (Cubic Method Two, see page 13)

Net volume is obtained by subtracting any defect volume from the gross volume to arrive at the net volume of the log, except in the case of sap rot where a net volume may be directly determined.

#### **Diameter Measurement**

Diameters are measured inside the bark in 2 centimetre size class intervals, with the class boundary occurring on the odd centimetre, and recorded in even centimetre classes. A scaled log that coincides with the class boundary of two size classes belongs to the lower size class.

	R	ange	
Diameter Class	<b>Lower Limit</b>	Upper Limit	
	7.1	0	
$D_8$	7.1 cm	9 cm	
$D_{10}$	9.1 cm	11 cm	
$D_{12}$	11.1 cm	13 cm	
$D_{14}$	13.1 cm	15 cm	
$D_{16}$	15.1 cm	17 cm	

Example: A diameter that falls on the <u>class boundary</u> between 10 and 12 centimetres (cm) must be read as 10 centimetres.

If a log has a regular sawn surface, a fair diameter measurement must be taken without seeking the largest or smallest diameter (Figure 2).



Figure 2 Measuring diameters: logs with regular sawn surfaces

Rounding diameters to even classes is required when averaging diameters based on two or more measurements, the average may result in an answer which is not in the class interval being used (e.g. odd numbers). When this occurs, the measurement for recording purposes will be the closest figure which is evenly divisible by four (4).

Logs with irregular sawn surfaces require at least two measurements taken at right angles to each other (through the shortest axis and longest axis of the sawn surface). When the average of two diameter measurements is an odd number, the diameter recorded is the closest even diameter evenly divisible by 4 (Figure 3).



Figure 3 Measuring diameters: logs with irregular sawn surfaces

#### Figure 3 example:

Two log measurements of 28 cm and 34 cm are taken.

$$\left(\frac{28+34}{2}\right) = \frac{62}{2} = 31 \ cm$$

Since 31 is an odd number, it cannot be recorded. The scaler must record 30 or 32. Since 32 is evenly divisible by 4 and 30 is not, the scaler records a **32 cm** diameter.

Oblong log diameters are measured as described in measuring logs with irregular sawn surfaces (figure 3). Add the diameter measurements together and divide by 2 to obtain the mean. If the mean is an odd number raise or lower the diameter to the closest even centimetre class that is evenly divisible by 4. Examples:

Measurements	Average	Recorded as
28 + 24 = 52/2 =	26 – in class interval	26
28 + 26 = 54/2 =	27 – not in class interval	28 (class interval, divisible by 4)
28 + 30 = 58/2 =	29 – not in class interval	28 (class interval, divisible by 4)
28 + 32 = 60/2 =	30 – in class interval	30
30 + 32 = 62/2 =	31 – not in class interval	<b>32</b> (class interval, divisible by 4)

Diameter Averaging Exercise: (answers in appendix 4)

Measurements	Average	Recorded as
44+46		
24+28		
34+40		

#### **Length Measurement**

The length of a log is the distance along the longitudinal axis between the two end planes perpendicular to this axis and passing through the geometric centre of the log.



Figure 4 Log length measurement

For the cubic method of wood measurement log lengths are usually measured and recorded in metres and 2 centimetre (.02) classes with the class boundary occurring on the odd centimetre class (Figure 5). Log lengths can also be measured in metres and 20 centimetre (0.2 m) classes with the class boundary occurring on the even centimetre if Table 3 or 4 is to be used for volume determination. Lengths are recorded in the odd centimetre class (Figure 6).



Figure 5 Length class determination in 2 cm class

Figure 5 example: Logs greater than 2.41 m in length, up to and including 2.43 m in length, are recorded as 2.42 m logs.

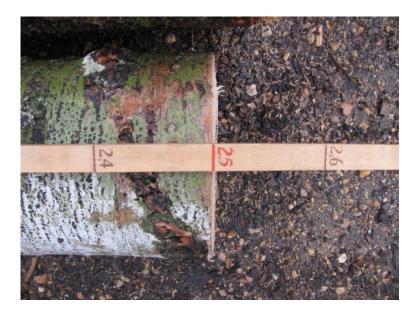


Figure 6 Length class determination in 20 cm class

Figure 6 example: Logs greater than 2.4 m in length, up to and including 2.6 m in length, are recorded as 2.5 m logs.

#### Cubic Method One: Measuring the Small End Only of a Log

Here, the gross volume of a log is determined by measuring the diameter of the top or small end of the log and the length and using the following taper formula:

$$V = L \times \frac{\pi}{40,000} \times [d_1 + (L \times 0.5)]^2$$

Where:

V =gross log volume in cubic metres

 $L = \log \text{ length in metres}$ 

 $\pi = 3.14159$ 

 $d_1$  = small or top end log diameter in centimetres

This formula assumes a taper of one cm per metre of length.

**Table 4** is used for gross volume determination when measuring the small end of a log. This table is constructed on the above taper formula for a selected range of lengths and top diameters. Log volumes in m<sup>3</sup> are listed by diameter class and 20 cm length classes.

#### Cubic Method Two: Measuring Both Ends of a Log - Smalian's Formula

The gross volume of a log is determined by using Smalian's formula which states: The volume of a log is the area of the small end, plus the area of the large end, both divided by two; then multiplied by the log length. All components must be in the same units. In symbol form Smalian's formula is:

$$V = \frac{A_s + A_l}{2} \times L$$

 $V = \log \text{ volume in cubic metres}$ 

 $A_s$  = area of small end in square metres

 $A_1$  = area of large end in square metres

## The end area of the small and large end of a log may be calculated by the following formulae:

$$A_s = \pi \left(\frac{ds}{2 \times 100}\right)^2 = \text{area (m}^2) \text{ of the small end of the log}$$

$$A_1 = \pi \left(\frac{dl}{2 \times 100}\right)^2 = \text{area (m}^2) \text{ of the large end of the log}$$

ds = diameter of small end in centimetres

dl = diameter of large end in centimetres

L =length of log in metres

 $\pi = 3.14159$ 

**Table 3** may be used for **gross log volume** determination when measuring both ends of a log if the log lengths have been measured in 20 cm classes with the class boundary occurring on the even cm class.

After gross log volume is determined using Smalian's formula or Table 3 allowable defect deductions calculated from **Table 3** are subtracted from the gross log volume to determine **net log volume**.

To determine cube scale volumes Table 2 can be used to find average end area; Volume  $m^3$  = average end area x length

**Table 2** indicates the area of circles in metres squared (m<sup>2</sup>) correct to four decimal places for diameters from 4 cm to 128 cm.

An alternate formula for determining the volume of a cylinder is identified below. It can be used for log volumes or defects.

$$\frac{D^2 \times 0.7854 \times L}{10.000} = \text{cubic metres correct to three decimal places}$$

Where: D = average diameter of log or defect in 2 centimetre classes L = length of log or defect in metres and 2 centimetre classes

L =length of log or defect in metres and 2 centimetre classes

#### **Butt Swell**

Visible butt swell can be removed by following the normal taper of the log to determine the large end diameter measurement (Figure 7).



Figure 7 Butt Swell

Cubic Method Two Example

Log #	Length	Dia. 1	Area 1	Dia. 2	Area 2	Volume m <sup>3</sup> Area 1 + Area 2  X length
1	2.52	30	.0707	28	.0616	(.0707 + .0616) / 2 X length = $.166$
2	2.48	18	.0254	20	.0314	(.0254 + .0314) / 2 X length = $.070$
3	2.54	24	.0452	22	.0380	(.0452 + .0380) / 2  X length = .106

Cubic Method Two Exercise: (answers in appendix 4)

Log #	Length	Dia. 1	Area 1	Dia. 2	Area 2	Volume m <sup>3</sup> Area 1 + Area 2  X length
1	2.54	28		30		
2	2.44	20		16		
3	2.56	16		18		

#### **Deductions in Cube Scaling**

Allowable defect deductions are subtracted from the gross log volume to determine net log volume. See the Deduction for Cull, Undersize, Defect and Void section for measurement details.

#### Stacked Wood Method

This method of scaling is used to determine stacked roundwood volume of rough or peeled wood piled in an orderly fashion in stacked cubic metres. *Unit of*Measurement = stacked cubic metre =  $m^3$  STK.

A stacked cubic metre is one cubic metre of stacked wood (whole or split, with or without bark) containing wood and airspace with all bolts of similar length piled in an orderly fashion with their longitudinal axis parallel (Figure 8).

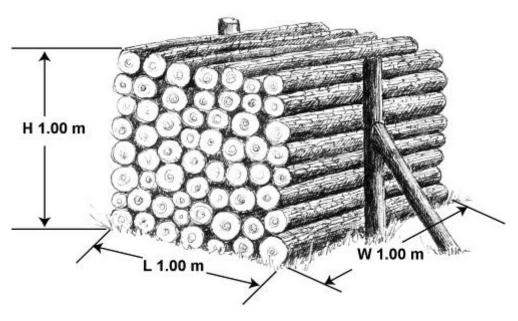


Figure 8 Stacked cubic metre

#### **Measuring Procedure**

Heights and lengths are measured on one side of the stack only, by means of an approved stacked wood scaling stick graduated in two centimetre classes and recorded in metres to two decimal places. The scaler must determine if there is an even distribution of tops, butts and defects on both sides of the stack. If there is a predominance of tops, butts or defects showing on one side of the stack, alternate sides must be measured from stack to stack to obtain a fair scale.

#### Length

Length of the stack is measured in metres and two centimetre size classes with the break occurring on the odd centimetre. Lengths are recorded in the even centimetre class. (Ex. Length 10.42 m, 25.64 m)

When a stack drops off in height at one or both ends, measure the length to a point on the slope of the stack where the area of the stack that is now cut off will fill the space required to square the stack (Figure 9).

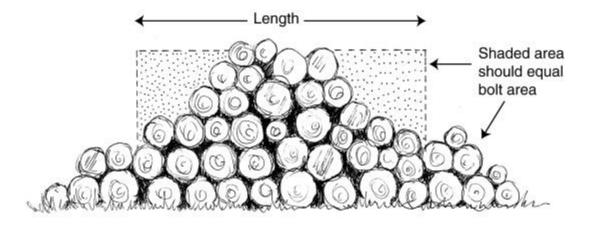


Figure 9 Measuring length of stack when stack drops off at both ends

On hillsides, measure the length of the stack parallel with the bottom of the stack (Figure 10).

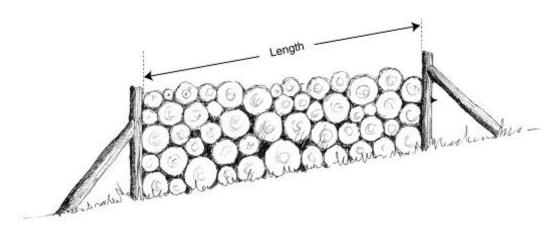


Figure 10 Measuring length of stack on a slope

The maximum recordable length of a stack is 30 metres. Where exceedingly long stacks are encountered, separate them into sections no longer than 30 metres. Measure and record each section as a separate stack and mark each section of the stack clearly with a line.

#### Height

Height is measured in metres and two centimetre size classes with the break occurring on the odd centimetre and recorded in even centimetre classes. *The maximum allowable height of a stack is 5 metres*. Stacks higher than 5 metres may have to be re-piled to permit safe and accurate measurement.

When a number of height measurements are averaged to two decimal places, odd numbers may be recorded for the height measurement. **Rounding of numbers does not apply to averaged stack heights**. The third and subsequent decimal places are disregarded.

Heights are measured at equal intervals along the length of a stack, and averaged to two decimal places to obtain the average height of a stack (Figure 11). When the ends of a pile with sloping ends are theoretically squared off to determine the pile length, the centre part of the pile with a relatively even height is considered the **working stack height**.

Figure 11 illustrates where the working stack height would be located. The first height measurement is to be taken at 0.5m from the beginning of the working height. Intervals between 1.0 - 3.0 m should be used depending on the uniformity of the stack height and overall length of the pile. More height measurements are required on stacks with irregular heights.

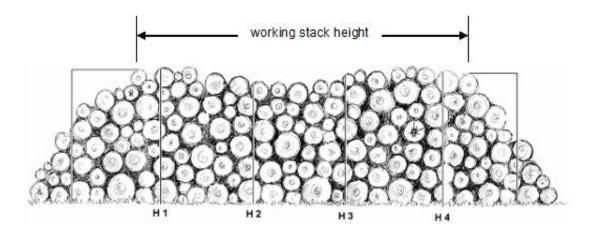


Figure 11 Measuring height of stack

Height 1=1.84 m, Height 2=1.78 m, Height 3=1.82 m, Height 4=1.84 m

Figure 11 example: Determining stack height from measurements taken at equal intervals along the length of a stack:

Average height of stack = 
$$\left(\frac{1.84 + 1.78 + 1.82 + 1.84}{4}\right) = \frac{7.28}{4} = 1.82 \text{ m}$$

Record the height as 1.82 m.

The height measurement commences on the lower edge of a bottom bolt or at the exterior tangent of two adjacent bottom bolts and terminates on the upper edge of a top bolt or exterior tangent common to two adjacent top bolts. This method can be used to smooth the pile height when a significantly different height measurement is indicated along each edge of the stacked wood stick. The reading is taken where the line transects the centre of the stacked wood stick. See Figure 12.



Figure 12 Measuring stack height using exterior tangents

Figure 13 example: Determining stack height from measurements taken at equal intervals on a loaded truck. Each tier is considered to be a separate stack and average height measurements must be obtained for each tier.



Figure 13 Height measurements taken on a loaded truck

Tier 1 
$$\frac{1.78 + 1.84}{2} = \frac{3.62}{2} = 1.81$$
 Tier 2  $\frac{1.84 + 1.86}{2} = \frac{3.70}{2} = 1.85$  Tier 3  $\frac{1.76 + 1.80}{2} = \frac{3.56}{2} = 1.78$  Tier 4  $\frac{1.82 + 1.84}{2} = \frac{3.66}{2} = 1.83$  Tier 5  $\frac{1.78 + 1.80}{2} = \frac{3.58}{2} = 1.79$  Tier 6  $\frac{1.82 + 1.90}{2} = \frac{3.72}{2} = 1.86$  Tier 7  $\frac{1.74 + 1.78}{2} = \frac{3.52}{2} = 1.76$ 

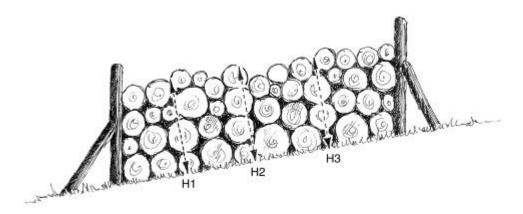


Figure 14 Measuring height of stack piled on a slope

Where wood is stacked on a slope, the height measurements are taken at right angles to the slope (Figure 14).

#### Width

The width of a stack is the actual length of the logs or bolts measured in metres and two centimetre classes with the break occurring on the odd centimetre and recorded on the even centimetre class. All the wood in one stack must be the same length. As the roundwood is put up in a pile, the stack width will be determined from log or bolt lengths selected on the pile top which are representative of the actual pile width.

When a number of width measurements are averaged to two decimal places, odd numbers may be recorded for the width measurement. **Rounding of numbers does not apply to averaged stack** widths. The third and subsequent decimal places are disregarded. Pile widths more than 2.80 metres cannot be stack scaled unless approved otherwise.

In application, the width of the pile will be calculated as the average of 10 log length measurements in metres and 2 centimetre classes. The calculated average pile width is allowed to be an odd number to the nearest centimetre for the purpose of calculating stack volume.

#### Example: 10 measurements

2.58 2.46 2.54 2.56 2.44 2.56 2.52 2.54 2.54 2.52 = 25.26/10 The average pile width is 2.52 m

#### **Calculation of Volume**

The stacked pile volume before deductions is found by multiplying the pile height times the pile length, times the pile width (Figure 15).

The formula is:  $GVS = H \times L \times W$ 

#### Where:

GVS = the gross volume of the stack of wood (expressed with a precision of 0.01 m<sup>3</sup> stacked)

H = the pile height in metres and two centimetre classes

L = the pile length in metres and two centimetre classes

W = the pile width (length of bolt) in metres and two centimetre classes

Figure 15 Example: A stack of wood measuring 2.50 m in height, 4.00 m in length and 2.60 m in width has a volume of  $2.50 \times 4.00 \times 2.60 = 26.00 \text{ m}^3 \text{ STK}$ 

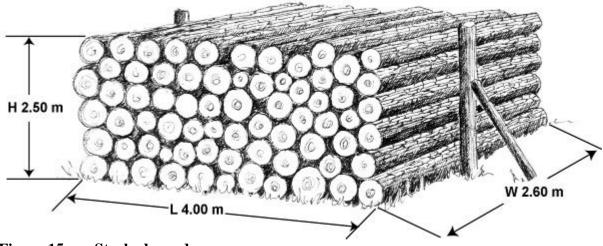


Figure 15 Stacked wood

#### **Deductions for Stack Scaling**

Deductions for cull, undersize, defect and void are permitted in stackwood scaling. They are measured with an approved scaling stick (MC-1, MC-2) graduated in two cm classes with the class boundary on the odd centimetre. They are calculated from diameter measurements of culls, undersize, defects and voids visible on the side selected for scaling and are assumed to extend the length of the log or width of the stack. It is assumed that there is an even distribution of defects on both sides of the stack. See the Deduction for Cull, Undersize, Defect and Void section for measurement details.

#### **Identification of Stacks**

When a stack has been measured, the scaler must mark the following information on one or more conspicuous bolts (Figure 16):

- stack number
- date
- scaler's initials
- any other information requested by NRND.



Figure 16 Stack identification

#### **Conversion Factors for Rough and Peeled Bolts**

Tests have determined that, on average, a stacked cubic metre of wood is made up of approximately:

66 %	wood
12 %	bark
<u>22 %</u>	air space
100 %	

#### Rough Wood Factor

To calculate the volume of stacked cubic metres of rough wood represented by **a** single bolt, undersize, defect, cull or void, the solid cubic metre volume must be multiplied by the rough wood factor 1.51.

The factor is derived as follows:

$$66\% wood = \frac{100\%}{66\%} = 1.51$$

Example: A single 18 cm x 2.5 m bolt has a volume of 0.064 m<sup>3</sup>. To determine the volume the single bolt represents in stacked cubic metres:  $0.064 \ m^3 \times 1.51 = 0.097 \ m^3$  STK correct to 2 decimal places

#### **Peeled Wood Factor**

To calculate the volume of stacked cubic metres of peeled wood represented by **a** single bolt, undersize, defect, cull or void, the solid cubic metre volume must be multiplied by the peeled wood factor 1.28.

This factor is derived as follows:

$$\frac{100\%}{78\%} = 1.28$$

Example: A single 18 cm x 2.5 m peeled bolt has a volume of 0.064 m<sup>3</sup>. To determine the volume the single bolt represents in stacked cubic metres peeled:

 $0.064m^3 \times 1.28 = 0.08 m^3$  STK correct to 2 decimal places

#### **Conversion Factors for Stacks**

To convert stacked cubic metres to solid cubic metres, <u>multiply</u> the volume in stacked cubic metres (correct to two decimal places) by:

0.664 for rough wood 0.781 for peeled wood

Round all volumes in solid cubic metres correct to two decimal places.

Example: A stack of rough wood has a volume of 36.05 m<sup>3</sup> STK. To determine the volume in solid m<sup>3</sup>:

$$36.05 \times 0.664 = 23.94 \, m^3$$

To convert solid cubic metres to stacked cubic metres, <u>divide</u> the volume in solid cubic metres (correct to three decimal places) by:

0.664 for rough wood 0.781 for peeled wood

Round all volumes in stacked cubic metres correct to two decimal places. Example: A stack of rough wood has a solid wood volume of 358.909 m<sup>3</sup>. To determine the volume in stacked m<sup>3</sup>:

$$358.909 \div 0.664 = 540.52 \, m^3 \, \text{STK}.$$

#### **Mass Scaling Method**

This system of scaling is used to determine the mass of quantities of roundwood, chip fibre and fuelwood in tonnes or kilograms. Units of mass are converted to units of volume by using mass/volume ratios developed for each species.

Manned or unmanned weigh scales are acceptable means of measuring provided they meet NRND standards. The Director of Forestry, in consultation with the appropriate industry representatives, must ensure scale operations meet all regulatory requirements.

Weighing devices, their manufacture, installation and use are regulated by the Weights and Measures Act of Canada. The act states that all weighing devices must be approved and certified prior to use and that any commodity, traded on the basis of weight, must be measured within the prescribed limits of error as defined in the regulations.

The Weights and Measures Act specifies those regulations pertaining to:

- the design, configuration and construction of weighing devices
- installation and use
- their performance

The Director of Forestry must approve all exceptions to the minimum facility standards.

All weighing devices will be operated within the standards as specified in the Weights and Measures Act. Scales will be maintained in good operating condition. The deck must be kept clear of ice, snow and other material that may accumulate during the hauling operation. When mass measuring is in progress the scale must be adjusted to read zero mass after each transaction. When mass scaling on a motor vehicle, the empty or tare weight of the vehicle shall be taken as soon as possible after unloading each time a mass is taken of the loaded vehicle.

#### Unit of Measurement - Kilogram or tonne

#### **Mass Scaling Measuring Procedure**

To mass scale Crown forest resources for Crown purposes, the weigh scale facility must conduct measuring procedures in the following manner:

- The weigh scale facility must be approved to measure unscaled Crown forest resources.
- A completed load slip will accompany each load of unscaled Crown forest resources to the weighing location.
- The gross mass (weight of tractor, trailer and load) and the tare mass (weight of the tractor and empty trailer) will be measured and recorded for each load.
- Every tractor and empty trailer must be weighed to determine its tare mass after the delivery of each load.
- If the gross mass includes the weight of the driver, then the tare mass must also include the weight of the driver.
- The tractor and empty trailer must not be cleaned of debris between the gross and tare measurements.
- The tractor must not be refuelled between gross and tare measurements.
- The net mass of the load is determined by subtracting the tare mass of the empty vehicle from the gross mass of the loaded vehicle.
- A mass scale slip/ticket that displays all information required for the identification of the load, will be produced.
- Vehicles used for hauling Crown forest resources to a weigh scale facility must be properly identified and the information recorded on the mass slip/ticket (Ex. truck/trailer licence plate numbers, truck owner/number).
- The weigh scale facility will maintain a record of all mass measured transactions in a manner approved by NRND.
- A schedule will be implemented for the timely submission of mass measure transactions to the Crown.

**Note**: Where the deck of the weigh scale is not long enough to accommodate the entire length of the tractor and trailer, the driver will place the entire trailer on the scale deck, detach the tractor from the trailer and remove the tractor from the deck prior to both (gross and tare) measurements.

## The practice of combining separate (split) axle weights to determine the gross mass or the tare mass is not permitted.

Where the weighing device becomes inoperable, an alternate method of measurement, acceptable to NRND, will be implemented.

#### **Calculation of Volume**

On mass measuring operations, for each harvesting authority, the following must be determined annually:

• for all softwoods and hardwoods: factors for undersize, cull and defect deduction and product(s)

#### **Applying Factors to Determine Volume**

- Each species has its own mass/volume ratio, derived from sampling program that converts the mass of the load from kilograms to solid cubic metres.
- For single species (pure) loads, calculate the gross volume of the load using the mass/volume ratio for that species.
- The undersize factor is applied to the gross volume for each species <u>prior to</u> applying defect factors.
- The net volume is determined by applying the defect factor to the sum of the gross volume less undersize.
- Volumes are expressed in cubic metres correct to two decimal places.

Example: Determining the gross volume of a single species (pure) load.

A load of jack pine logs is delivered to a mass measuring site:

Gross weight is 62,780 kgs

Tare weight of the tractor and trailer is 20,490 kgs.

For this example the mass/volume ratio for jack pine is 808 kgs per cubic metre of solid wood.

#### Step # 1

Calculate the net weight of the load:

Gross weight 62,780 kgsTare weight -20,490 kgsNet weight of load 42,290 kgs

Net weight of load is 42,290 kgs.

#### Step # 2

Calculate gross solid cubic metres of jack pine in the load:

$$42,290 \text{ kgs} \div 808 \text{ kg/m}^3 = 52.3391 = 52.34 \text{ m}^3$$
 (correct to 2 decimal places)

Gross volume of jack pine is  $52.34 \text{ m}^3$ .

Example: Determining the <u>net volume</u> of a single species (pure) load.

To determine the net volume of the load, the undersize and defect, if applicable, must be deducted from the gross volume. Using the gross volume from Example 1, apply an undersize factor of 3.1 per cent and a defect factor of 7.5 per cent to calculate net volume.

#### Step#1

Reduce the volume of the load by removing the undersize material:

Gross volume is 52.34 m<sup>3</sup>

Undersize factor is 3.1%

Factor to calculate gross volume less undersize 100% - 3.1% = 96.9% or 0.969 Gross volume less undersize  $= 52.34 \times 0.969 = 50.71746 = 50.72$   $m^3$  (correct to two decimal places)

#### Step # 2

Further reduce the volume by removing the <u>defect material</u> to determine the net volume:

Defect factor is 7.5%

Factor to calculate volume less defect 100% - 7.5% = 92.5% or 0.925

Net volume =  $50.72 \times 0.925 = 46.916 = 46.92 \, m^3$  (correct to two decimal places)

Therefore the **net volume** of the load is **46.92** m<sup>3</sup>.

#### **Identification of Load**

Each mass scale slip must show the following information:

- load slip number
- mass scale slip number
- harvesting authority number (forest management licence, timber sale, timber permit, patent land)
- gross mass of loaded vehicle in kilograms
- tare mass of empty vehicle in kilograms
- net mass of load in kilograms
- date
- species
- mass measuring location
- final destination of load
- truck identification (Ex: licence plate numbers, trucker's name)
- scale operator signature
- any other information requested by the Director of Forestry

#### Sample Scaling Method

#### **Application of Sample Scaling**

The principle of sample scaling is that certain characteristics of a large group of similar items can be determined as accurately from a small sample of those items as from measuring the entire group. For example, when sample scaling, only a small proportion of timber piled in a landing is measured. This measured sample is used to determine the total volume of the landing. The emphasis is on the care of measurement and the unbiased selection of the measured sample.

A sample scaling procedure must be applied carefully to ensure that the Crown forest resources measured are representative of all the Crown forest resources harvested. The percentage measured may vary depending on the scaling method used.

The approved scaling percentages are as follows:

- 100 per cent scale all methods of measurement
- 10 per cent sample scale approved for fixed length cube scale operations only

**Note**: The sample scaling percentage for containers (Ex: rail cars, trucks, verifying factors) is stated in the sampling plan and the scaling agreement.

#### **Design of a Sample Survey**

- the objective must be clearly stated
- the population will be defined
- the data required to be collected will be specified
- the units to be sampled will be defined
- all measuring (scaling) procedures must be clearly set out
- the desired precision will be specified
- the sampling method will be described in as much detail as necessary
- when there is information lacking on the population in order to determine a sample size, a pre-test will be made
- the organization of the field work will be set down
- the summary and analysis of the data will be detailed

Note: for a complete description of the mathematical procedures commonly used in sample scaling see CSA Standard: Scaling Roundwood 0302.1-15, Section 9

## **Piece and Linear Scaling Method**

Piece and linear scaling is used to describe a quantity of primary forest products resulting in a scale consisting of a piece count or a summation of lengths with a criteria description in metric units. A procedure description of the measurement methods can also be included.

Piece and linear scaling is used for many diverse products and requires the use of descriptive criteria such as species, diameter (cm), length (m) and allowable defects.

Often this scale is converted to a volume or mass description of quantity. However, when determining mass or cubic content is the primary purpose of the scale, piece and/or linear scaling should **not be used**.

Example: To determine the volume of the following material.

100 posts – 16 cm average diameter and 2.5 m in length 1000 lineal metres of rails – 10 cm average diameter and 5 m in length

from Table 3 - a post with 16 cm average diameter and 2.5 m length has a volume of .05 m<sup>3</sup>.

volume of posts -  $100 \times .05 = 5 \text{ m}^3$ 

from Table 3 - a rail with 10 cm average diameter and 5 m length has a volume of  $.038 \text{ m}^3$ .

number of rails - 1000 lineal metres / 5 metres = 200 rails

volume of rails -  $200 \times .038 = 7.6 \text{ m}^3$ 

5.0 m<sup>3</sup> posts 7.6 m<sup>3</sup> rails 12.6 m<sup>3</sup> total volume

#### **Deductions for Cull, Undersize, Defect and Void**

#### Cull

A cull piece is a log, bolt, or tree length having more than 50 per cent of its volume defective. Culls can be determined by comparing the square of the defect diameter with the square of the sawn surface diameter. If the square of the defect diameter is greater than 50 per cent of the square of the sawn surface diameter, the log is a cull. The cull piece is clearly marked by placing an X across the scaled end. The recording of a cull piece is handled either by omitting it from the gross scale record or by assigning a deduction equal to its original volume.





Figure 17 Cull logs

Example: A log with a gross diameter of 32 cm has a 26 cm defect on the measured end. The square of the log diameter is  $32 \times 32 = 1024 \text{ cm}^2$ . The square of the defect diameter is  $26 \times 26 = 676 \text{ cm}^2$ .

Area: gross diameter 32 cm (Table 1)  $= 32 \times 32 = 1024 \text{ cm}^2$ Area: defect diameter 26 cm (Table 1)  $= 26 \times 26 = -676 \text{ cm}^2$ Sound portion  $= 348 \text{ cm}^2$ 

Since 676 is more than half of 1024, the log is a *cull*.

Comparing the square of the defect diameter to the square of the log diameter using Table 1 is one method of determining if a log is a cull or not. In most cases it is more efficient than determining the volume of the defect and the volume of the log before making any determination on cull.

Alternatively a cull piece can be determined from the diameter reductions on the MC-1 or MC-2 scaling stick. If the defect is larger than the largest diameter listed under each diameter class the piece is a cull.

Example: A log with a gross diameter of 32 cm has a 26 cm defect on the measured end. On the MC-1 scaling stick the largest defect diameter listed under 32 cm is 22 cm; therefore the log is a cull.

#### Undersize

Undersize is defined as unmerchantable timber that is smaller than the minimum top diameter utilization standard diameter class. Undersize may only be applied in commercial timber operations and is not for application in personal use or fuelwood operations.

In commercial operations undersize timber would be the portion of:

- softwood timber that has been harvested for use that has a diameter less than 10 centimetres (diameter class)
- hardwood timber that has been harvested for use that has a diameter less than 12 centimetres (diameter class)

If deductions are being made for undersize material, this deduction must be made before any defect deduction is applied. Defect deductions are applied only to merchantable material. There are no deductions for defect in undersize material.

The scaler will not reduce gross diameter of the undersize piece if a defect is encountered. **Any bolt with a diameter less than 6 centimetres is ignored.** 

In the stacked method all undersize bolts in the stack will be scaled on the side of the stack being measured and their gross volume recorded in stacked cubic metres. Deductions are made in the same manner as for culls.

**Undersize in Fuelwood** – There are no deductions for cull, defect or undersize when measuring fuelwood. Only voids are deducted from fuelwood.

#### Defect

The definition of a defect is naturally missing or charred wood, and rot or advanced decay. Volume deductions are allowed as identified for each scaling system.

All <u>sound or merchantable pieces</u>, regardless of their diameter, length and species, must be scaled and reported to NRND; they cannot be considered rejects or culls.

No allowances for sawmill trim or broomage are permitted outside of the size class interval established in the scaling system.

Defects are measured in the same way as gross diameters, in two centimetre size class intervals, with the class boundary occurring on the odd centimetre. Defects are recorded in even centimetre classes.

The volume of a defect is determined using the geometric solid that best represents the shape of the defect. Defect volume determination is normally a product of the average cross-sectional area of the defect times the length affected. Measurements are made in the same units that are used to scale the log.

Enclose the defect in the smallest rectangle possible and obtain the length and width of this rectangle. Add these measurements together and divide by two to obtain the mean. If the mean is an odd number, raise or lower the diameter to the closest even centimetre class that is evenly divisible by four.

When a defect is visible on both ends of a log, measure the defect **on both ends of the log** to obtain the mean defect diameter.

In stack scaling use the defect diameter to calculate the volume of the defect. This can be read directly from the cube scaling stick (for 2.54 m length bolts) marked in hundredths of a stacked cubic metre.

Example: A log contains a defect that measures 10 by 14 cm.

$$\left(\frac{10+14}{2}\right) = \left(\frac{24}{2}\right) = 12 \ cm$$

The diameter of defect is 12 cm.

Example: A log contains a defect that measures 12 by 18 cm.

$$\left(\frac{12+18}{2}\right) = \left(\frac{30}{2}\right) = 15 \ cm$$

The diameter of the defect is 15 cm.

Since 15 is an odd number, the scaler must raise this diameter to 16 cm (16 is evenly divisible by four while 14 is not). Therefore, the diameter of the defect is 16 cm.

**Note:** In the cubic method of measurement:

- no deduction is made for crook, sweep or seams
- no deduction is made for stain or mechanical damage
- sound dry wood is not considered a defect

# Full Length Heart Rot (FL)

Heart rot is a very common defect. Full length heart rot is measured as a normal log when the defect shows at both ends.





Figure 18 Heart rot

The defect area for heart rot is calculated out as shown below:

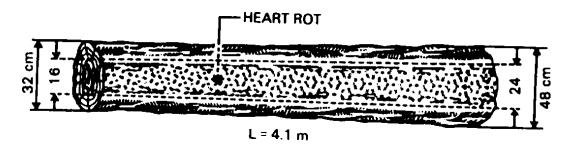


Figure 19 Full length heart rot (showing at both ends)

# Figure 19 example:

Using true cylinder tables (Table 3)		
Log length	=	4.1 m
Gross log diameter (32+48)/2	=	40 cm
Defect diameter (16+24)/2	=	20 cm
Gross log volume (see table 3)	=	$0.515 \text{ m}^3$
Defect volume (see table 3)	=	0.129 m <sup>3</sup>
Net Log Volume	=	$0.386 \text{ m}^3$

#### Half Length Defect (HL)

When the defect shows only at one end, the volume should be one half the volume of a cylinder. Normally Smalian's formula is used to calculate this defect's volume. Had the defect in the example shown (Figure 19) only occurred in the small end (16 cm diameter) the deduction would have been:

## Example:

=	4.1 m
=	40 cm
=	$0.515 \text{ m}^3$
=	16cm
82) =	0.041 m <sup>3</sup>
=	0.474 m <sup>3</sup>
	=

#### **Butt Length Defect (BL)**

This defect is restricted to rot in the end of the log which was originally attached to the stump and seldom extends far into the log. Ordinarily, it reduces in size from the end of the log inward (Figure 20).

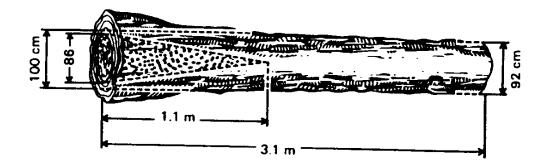


Figure 20 Butt rot

Unless there are indications otherwise, the length of the penetration shall be assumed to be 1.1 m (based on field sampling by NRND staff) and the formula to determine the defective volume is a paraboloid with the following formula:

$$V = \frac{1}{2} \times A \times L$$

#### Where:

V =volume in cubic metres

A = defect area in square metres

L = defect length in metres (1.1 m)

#### Note:

- this rot may be easily confused with heart rot
- honeycomb decay or missing wood typically caused by ants in the tree's butt can be classified as butt rot.

# Figure 20 example:

Using true cylinder tables (Table 3)

Log length = 3.1 mGross log diameter (100+92=192/2) = 96 cmGross log volume (see table 3) =  $2.244 \text{ m}^3$ Defect diameter (at the butt end) = 86 cm  $\frac{1}{2} 1.1 \text{ m}$  defect volume (see table 3) =  $0.320 \text{ m}^3$ Net Log Volume =  $1.924 \text{ m}^3$ 

### **Butt End Defect Greater Than 75% of Butt End (R1M)**

Severe butt rot which affects more than three quarters (75 per cent) of the butt end area shall be handled by reducing the log length by one metre.





Figure 21 Butt rot

# Figure 21 example:

Log length 5.1 m

Butt diameter = 90 cm Butt area =  $.6362 \text{ cm}^2$ Butt rot defect = 80 cm Butt rot area =  $.5027 \text{ cm}^2$ 

Percentage of butt rot area = .5027/.6362 = 79%

Gross log length is 5.1m

Merchantable log length is 5.1m - 1.0 m = 4.1 m

### **Punk Rot**

This rot may be fully confined to the heart of the log or it may touch the outer surface (Figure 22).





Figure 22 Punk rot

#### **Long Narrow Defects**

When the length of a defect is more than twice its width, the scaler must first calculate the area of the defect by multiplying the length by the width. The diameter of the defect is then determined by obtaining the square root of this number and raising or lowering it to the closest perfect square root that is an even number.

### Table 1 shows the squares of all even numbers from 4 to 90.

Example: A defect measures 22 by 8 cm. Since the length is more than twice the width, the area of the defect is determined by multiplying  $22 \times 8 = 176 \text{ cm}^2$  (Figure 23).

Since  $\sqrt{176} = 13.3$  and 13.3 is an odd number, it must be raised or lowered to the closest perfect square root that is an even number, which is 14. Therefore, the diameter of the defect is recorded as 14 cm.

An alternative way of determining the diameter of the defect for the same example would be by referring to the table of squared numbers in Table 1. Note that 176 falls between  $144 (12^2)$  and  $196 (14^2)$ . Since 176 is closer to 196, the diameter of the defect is 14 cm.

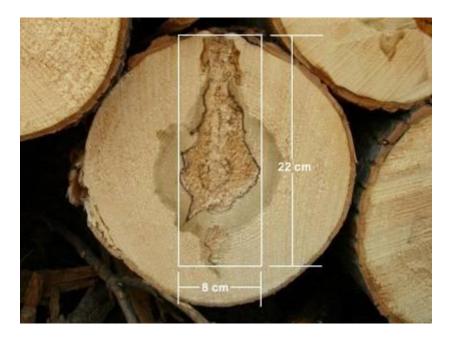


Figure 23 Long narrow defect that measures 22 cm x 8 cm

### **Heart Check**

Over mature timber often shows a heart check, which may extend only part way into the log or may appear on both ends. Heart check must not be confused with sun check or with checks resulting from the normal drying process (Figure 24).





Figure 24 Heart check on the end surface of a log

# Figure 24 example:

heart check 2 cm x 8 cm = 16 cm,  $\sqrt{16}$  = 4 cm diameter heart check 2 cm x 10 cm = 20 cm,  $\sqrt{20}$  = 4.472 cm diameter 4.472 must be raised or lowered to the closest perfect square root that is an even number = 4 cm diameter

#### **Defects Separated by 14 Centimetres or Less**

If a log contains two separate defects that are separated by 14 centimetres or less of sound wood, they must be considered as one defect. The scaler must enclose them in a rectangle to obtain the diameter of the defect (Figure 25).



Figure 25 Two defects separated by 14 cm or less

Example: A log contains two defects that are separated by 12 cm of sound wood. The scaler encloses these defects in a rectangle measuring 16 by 40 cm. Since the length is more than twice the width (long narrow defect), the scaler must calculate the area of the defect, obtain the square root and raise or lower this number to the closest perfect square root that is an even number. Area of defect =  $16 \times 40 = 640 \text{ cm}^2$ .

$$=\sqrt{640}=25.3$$

The diameter of the defect is 26 cm.

Example: A log contains two defects that are separated by 10 cm of sound wood. The rectangle enclosing these defects measures 12 by 20 cm

$$\left(\frac{12+20}{2}\right) = \left(\frac{32}{2}\right) = 16 \ cm$$

The diameter of the defect is therefore 16 cm.

An alternative way of determining the diameter of the defect for the same example would be by referring to the table of squared numbers in Table 1. Note that 240 (12 x 20 = 240) falls between 196 (14<sup>2</sup>) and 256 (16<sup>2</sup>). Since 240 is closer to 256, the diameter of the defect is <u>16 cm</u>.

#### **Defects Separated by More Than 14 Centimetres**

When two defects are separated by more than 14 centimetres of sound wood, the scaler must calculate the area of each defect, add them together, and obtain the square root of this total. This result will then be raised or lowered to the closest perfect square root that is an even number to determine the defect diameter.

Example: A log contains two defects. One measures 10 by 12 cm and the other measures 10 by 14 cm. They are separated by 16 cm of sound wood.

Area of defects 
$$= 10 \text{ x } 12 = 120 \text{ cm}^2$$
$$= 10 \text{ x } 14 = \frac{140 \text{ cm}^2}{260 \text{ cm}^2}$$

$$=\sqrt{260}=16.12$$

Therefore, the diameter of the defect is <u>16 cm</u>. This can also be determined by referencing Table 1 in the appendices.

### Sap Rot Defect

Sap rot is a defect confined to the outer circumference of the log where the heartwood may be unaffected and sound. Diameters must be determined for both the gross and the sound portions of the log. The square of the sound diameter, subtracted from the square of the gross diameter, represents the square of the defect. If the square of the defect is less than the square of the sound diameter, the log is not a cull and the diameter of the sound portion is recorded.

Example: A log has a diameter of 40 cm and a sap rot on the circumference; leaving 32 cm of sound wood (Figure 26).

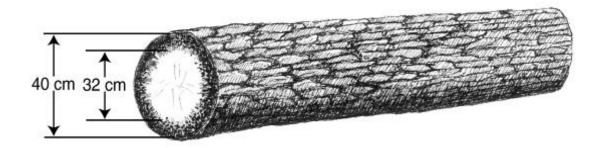


Figure 26 Sap rot

Gross diameter<sup>2</sup> (40 x 40) =  $1600 \text{ cm}^2$ Minus diameter<sup>2</sup> of sound wood (32 x 32) =  $-\frac{1024 \text{ cm}^2}{576 \text{ cm}^2}$ 

Since the squared diameter of the defect portion is less than the squared diameter of the sound portion, the log is not a cull. The diameter of the sound portion of the log is recorded as 32 cm.

### **Pipe and Pocket Rot**

These rots are varied and their volume is generally calculated by their cross-sectional area times their length.

$$V = A \times L$$

Where:  $A = \text{defect area in } m^2 \text{ and is usually a circle or rectangle}$ L = length of defect in meters.

Included in this class of rots are end checks and splits which warrant a deduction for missing wood.

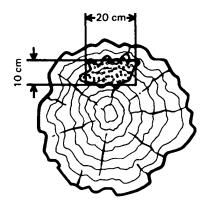


Figure 27 Pipe and pocket rot

Example: (see figure 27)

Area of Pipe Rot: 
$$\frac{L}{100} \times \frac{W}{100} = \frac{20}{100} \times \frac{10}{100} = 0.020 m^2$$

### **Dead Side or Seam Defect or Rot**

This class of defect is typified by a split or opening running along some or all of the total log length. Seams that will be eliminated in the manufacturing process are not considered defects.

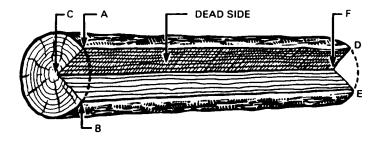


Figure 28 Dead side or seam defect or rot

In cross section it is pie shaped. The formula for its volume is:

$$V = A \times \frac{K}{C} \times L$$

Where:

 $A = \text{area of end circle in } m^2$ 

K = arc length of defect in cm (measured from point A to point B)

C =end circle circumference in cm

 $L = \log \text{ length in metres}$ 

V =volume in cubic metres

An alternate dead side volume calculation is easily found by taking the percentage of the defect sector's angle to 360° and applying the result to the gross log volume.

$$VD = VL \times \frac{\text{Sector's angle in degrees}}{360^{\circ}}$$

Where:

VD = volume of defect in  $m^3$ 

 $VL = \text{volume of log in m}^3$ 

This must be further modified if the dead side is not the full log length, or differs considerably at the other end.

#### **Church Door or Catface**

This defect's volume will normally be a judgement estimate.

#### **Crotch or Forked Top**

The crotch or forked top log is determined by measuring an inside bark diameter at the narrowest point below the fork. The diameter is then reduced by one centimetre for every metre of length the narrowest point falls below the top end of the log. This will then yield a small end diameter for recording purposes.

Example: A minimum diameter (inside bark) of 44.0 cm was determined about 2.0 m below the top end of a forked log. The top end diameter is to be recorded as 42 cm (44.0 - 2.0). Table 4 is used to determine the volume of the log.

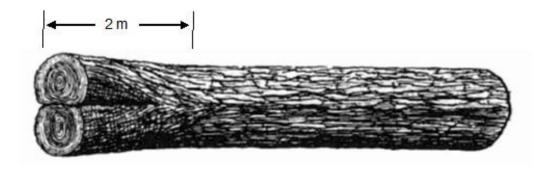


Figure 29 Crotch or Forked Top

#### Void

Void is a <u>space in the face of a pile</u> which will at least accommodate the average size (diameter) bolt within the pile of wood being scaled. The volume to be deducted will be the product of the number of average bolts required to fill the void times the volume of the average bolt. Voids are not observed along the top or bottom edge of stacked piles.

Example - use of MC-1 scaling stick: if a void in a pile of pulpwood will accommodate 3 average size bolts and their diameter is 12 cm, then the total deduction will be  $0.13 \text{ m}^3 \text{ STK}$  (by formulae) or  $0.12 \text{ m}^3 \text{ STK}$  by direct reading from the MC-1 scaling stick, for a bolt length of 2.54 m ( $3 \times 0.04 \text{ m}^3 = 0.12 \text{m}^3 \text{ STK}$ ).

The volumes by diameter class for cull, defect, void and undersize shown on the MC-1 stick are for wood 2.54 m in length. If the length of wood being measured is different than 2.54 m, the volumes of cull, defect, void and undersize must be calculated by formulae.

Calculating Volume of Cull, Defect or Void by formula:

$$Vdf = A \times L \times factor (1.51)$$

Where:

Vdf = volume of cull, defect, or void expressed with a precision of 0.001 m<sup>3</sup> (stacked)

$$A = \pi \left(\frac{D}{2 \times 100}\right)^2$$

 $\pi = 3.14159$ 

D = diameter of cull, defect or void in centimetres

L = length of log in metres when scaling on one side of the pile, and when scaling on both sides, L is  $\frac{1}{2}$  the log length

Factor = a factor for expanding the volume to account for bark and air space

The MC-1 and MC-2 scale sticks, contain built-in allowance factors for bark and air space, and can be used to directly measure the stacked cubic metre content of a cull, defect or void, for a 2.54 m bolt length.

### Example: Defects in Cube Scaling

Butt length defect – BL

- diameter of defect x 1.1m = volume of defect in m<sup>3</sup>
- use Table 3 volume for 1.1 m divided by 2
- must be the large end of the butt log (originally attached to the stump)
- defect must show in butt end only

#### Half length defect – HL

- diameter x length = volume of defect m<sup>3</sup>
- use Table 3 volume divided by 2
- used on logs that are not a butt log
- defect shows on only one end
- assume defect goes ½ length

#### Full length defect – FL

- average diameter of defect x full length = volume of defect m<sup>3</sup>
- use Table 3
- defect shows on both ends
- diameter of defect measured at both ends of log and averaged
- full log length

R1M – reduce log length by 1 m when the defect affects more than 75% of the butt area. This is normally associated with honeycomb caused by ants in the butt end of a tree originally attached to the stump.

# Example: Defect Deductions for Cube Scaling

Log length	Small end diameter	Gross Volume m <sup>3</sup> (table 4)	Defect	Defect Volume m <sup>3</sup>	Net Volume m <sup>3</sup>
3.7 m	44 cm	0.611	BL 24 cm	.050/2 = .025	0.586
4.9 m	32 cm	0.457	BL 12 cm	.012/2 = .006	0.451
5.1 m	26 cm	0.326	HL 18 cm	.130/2 = .065	0.261

Defect Deductions Exercise: (answers in appendix 4)

Log length	Small end diameter	Gross Volume m <sup>3</sup> (table 4)	Defect	Defect Volume m <sup>3</sup>	Net Volume m <sup>3</sup>
3.7 m	34 cm		BL16 cm		
4.9 m	42 cm		BL 12 cm		
5.1 m	36 cm		HL 20 cm		

### Example: Net Pile Volume of Stacked Wood

The net pile volume is the gross pile volume minus any allowable deductions for cull, defect, void and undersize. All volumes are recorded in stacked cubic metres.

In figure 30 the stack of 2.54 m rough wood is 7.32 m long and 1.28 m high. In addition to sound wood, it contains the following defects, voids and undersize bolts:

- two 8 cm jack pine undersize bolts
- one 30 cm spruce bolt with a 24 cm defect
- one 26 cm jack pine bolt with a 16 cm defect
- four 12 cm voids

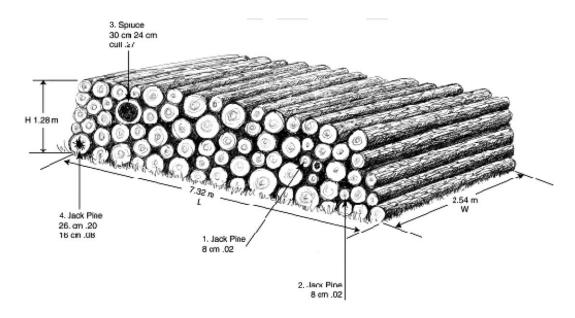


Figure 30 Net pile volume

To determine the net volume of wood in this stack (Figure 30):

# Step # 1

#### Gross Volume of stack is:

 $H \times L \times W$  = stacked cubic metres correct to 2 decimal places  $1.28 \times 7.32 \times 2.54 = 23.79898 = 23.80 \text{ m}^3 \text{ STK}$ Gross volume of the stack is  $23.80 \text{ m}^3 \text{STK}$ 

### Step # 2

Calculate the volume of undersize, cull, defect, and void in the stack:

#### **Undersize Deduction**

Two bolts 8 cm diameter =  $0.02 \text{ m}^3$  STK as read from MC-1 stick

Undersize volume =  $0.02 \times 2 = 0.04 \text{ m}^3 \text{ STK}$ 

Undersize volume of the stack is 0.04 m<sup>3</sup> STK.

## **Cull Deduction**

30 cm in diameter with a 24 cm defect is a cull

30 cm diameter =  $0.27 \text{ m}^3 \text{ STK}$  as read from MC-1 stick

Defect volume of this bolt is 0.27 m<sup>3</sup> STK

# Defect deduction

26 cm in diameter with a 16 cm defect. This is not a cull.

16 cm diameter =  $0.08 \text{ m}^3 \text{ STK}$  as read from MC-1 stick.

Defect volume of this bolt is 0.08 m<sup>3</sup> STK.

### Void deduction

12 cm diameter voids =  $0.04 \text{ m}^3 \text{ STK}$  as read from MC-1 stick

Deduction volume of voids =  $4 \times 0.04 = 0.16 \text{ m}^3 \text{ STK}$ .

Total deduction volume of the stack is 0.04 + 0.27 + 0.08 + 0.16 = 0.55 m<sup>3</sup> STK.

Calculate the net volume of the stack:

Gross volume of stack = 23.80 Less undersize volume = 0.04 Less cull and defect volume = 0.35 Less void volume = 0.16

Net volume of stack =  $23.25 \text{ m}^3 \text{ STK}$ 

Solid wood volume of stack (x .664) =  $15.44 \text{ m}^3$  solid

# VII. Infractions and Wasteful Practices Involving Crown Forest Resources

# **Infractions**

All measurements of Crown forest resources relating to fines or penalties for unauthorized or improper harvesting and unauthorized hauling of Crown forest resources must be conducted by licensed and approved scalers or in a manner approved by NRND, such as an officer's estimate of the gross volume of the timber wasted.

### **Wasteful Practices**

#### **Leaving High Stumps**

It is a wasteful practice to leave high stumps. Stump height is the vertical distance between the horizontal plane through the highest point of the stump and the horizontal plane through the highest point of the ground (includes boulders) at its base (Figure 31). A tree must be felled so that its stump height is equal to or less than 30 centimetres.

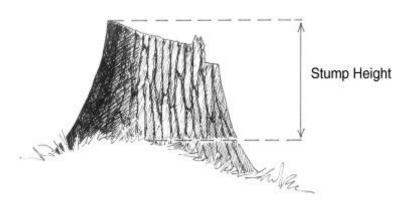


Figure 31 Stump height

#### **Leaving Merchantable Timber of Any Length**

It is a wasteful practice to leave merchantable timber of any length in any part of an approval area at the time when a licensee has:

- moved their operation to a different harvest block
- scaled the timber for Crown charges
- not scaled the timber for Crown charges
- abandoned their operating licence
- failed to renew their operating licence

#### Merchantable timber means:

- any softwood log in which more than one half the total content, measured in cubic metres, is sound wood
- in the case of a felled softwood log having a diameter of 10 centimetres (diameter class) or more inside the bark (DIB), at the smaller end (Figure 32)



Figure 32 Merchantable softwood timber

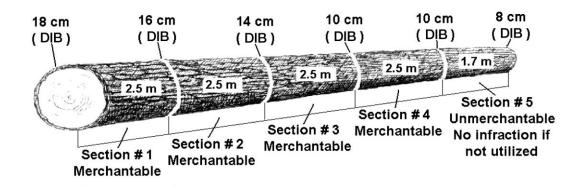


Figure 33 Softwood timber with unmerchantable section

- any hardwood log in which more than one half of the total content measured in cubic metres is sound wood
- in the case of felled hardwood timber having a diameter of 12 centimetres (diameter class) or more inside the bark (DIB), at the smaller end (Figure 34)

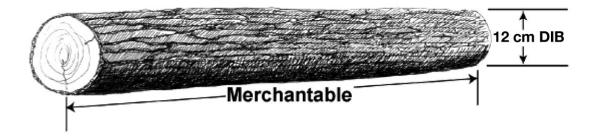


Figure 34 Merchantable hardwood timber

**Heavy branching** means the lowest part of a tree where the growth of branches is so concentrated that the timber in that section is considered unmerchantable.

The term "merchantable timber of any length" does not apply to **all hardwoods and conifers** beyond the point of heavy branching where a piece less than 2.5 metres remains (Figure 35).

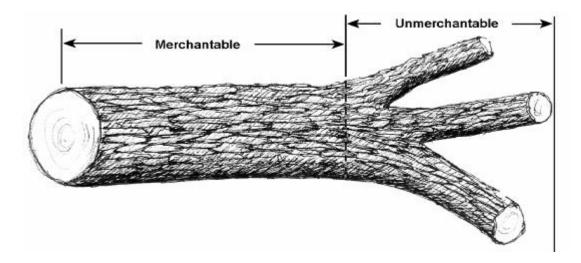


Figure 35 Unmerchantable sections that are less than 2.5 metres in length in an area of heavy branching

The term "merchantable timber of any length" does not apply where a piece less than 2.5 metres in length remains after an unmerchantable section is encountered on the top end of the stem only (Figure 36).

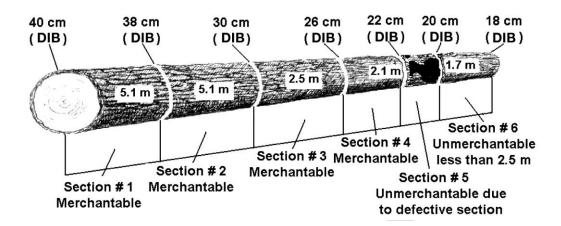


Figure 36 Timber with unmerchantable sections

# **Not Utilizing Wood Chip Fibre**

# It is a wasteful practice not to use wood chip fibre.

Wood chip fibre is chip fibre of any species produced by a chip manufacturing facility, whether fixed or mobile.





Figure 37 Un-utilized wood chip fibre.

#### **Assessment of Penalties**

Administrative penalties for wasteful practices, as defined by the minimum utilization standards described in this manual:

An administrative penalty for wasteful practices may be assessed even if the timber:

- has been measured, stumpage values collected and no reasonable market opportunity exists
- has been measured and stumpage values have not been collected
- has not been measured

### **Unauthorized Harvesting**

Unauthorized harvesting or possession of unauthorized Crown forest resources occurs in any of the following situations:

- a person harvests resources in a Crown forest without the authority of a licence
- a person fails to comply with the terms of a licence
- a licensee harvests Crown forest resources without a work permit
- a licensee harvests Crown forest resources outside the licence area

## **Unauthorized Hauling of Crown Forest Resources**

Unauthorized hauling is the movement of Crown forest resources from the place of harvesting before measurement, without the written approval of the Director of Forestry.

# VIII. Movement and Measurement of Crown Forest Resources

# **Scaling Plans**

Scaling plans are documents communicating the most likely licensed scaler to measure crown wood and the destination of the crown wood. Scaling plans may also be used by NRND to establish an agreement with industry for the measurement and reporting of scaling data for Crown wood not being sent to a weigh scale. (see appendix 5)

Scaling Plans address elements such as:

- parties to the agreement
- name and licence number of licensed scaler
- scaling location
- scaling method
- method and schedule of reporting measurement data
- management of records
- final destination
- estimated volume
- other elements as required

#### **Movement of Unscaled Crown Forest Resources**

Unscaled Crown forest resources must not be moved from the place of harvest without authorization of the Director of Forestry.

Unless permitted under an approved scaling plan or by a written authorization from an officer, no Crown timber cut under the authority of a commercial timber cutting right may be removed from the area where it was cut unless it has been scaled by a scaler (Forest Use and Management Regulation).

# **Load Slip**

Load slips are required for the movement of Crown forest resources and to help tracking and auditing. (appendix 6 and appendix 7)

All load slips must:

- be approved by NRND
- be pre-numbered consecutively on all copies
- contain the following minimum information:
  - shipper/seller name and address
  - receiver/purchaser name and address
  - cutting authority
  - signature of timber owner/designate
  - species/product
  - estimated quantity of timber
  - date/time loaded
  - truck/trailer licence numbers
  - truck operator signature
  - transaction number
  - receiver signature
  - date/time received

# **IX.** Sampling for Factors

When the calculation of volumes and determination of stumpage values requires the application of scaling factors, it is critical to both the forest industry and NRND that accurate factors be developed and maintained. To ensure the accuracy of data collected during sampling, only licensed, approved, experienced scalers must be assigned to this work. They should be regularly check scaled. The allowable margin of error is  $\pm 3$  per cent of the official check scale.

All sampling for these factors requires a well-designed sampling plan approved by NRND.

The types of sampling carried out in the province are:

- Mass/Volume: This sampling is required when Crown forest resources are mass measured to determine a weight to volume ratio. The procedure is detailed in the Mass Scaling Method section. See appendix 9 for a sample tally sheet.
- Undersize and Defect: Determination of undersize and defect factors is required where Crown forest resources are mass or tree length scaled for a number of mill facilities in Manitoba. See appendix 10 for a description of the procedures and a sample tally sheet.
- **Chipperwood:** Sampling of chipperwood is required to verify undersize percentages for mill facilities in Manitoba. See appendix 11 for a description of the procedures and a sample tally sheet.
- **Post and Rail:** Sampling is required at mill facilities producing post and rail material. See appendix 12 for a description of the procedures and a sample tally sheet.

# X. Information Collection and Management

#### **Data Collectors**

Data collectors are portable computerized units used for recording data. They must meet standards that allow for collecting and transferring data to NRND's data management system. Data from the units must be downloaded and backed-up regularly. A hard copy of all data must be available upon request by NRND. Use of data collectors must be approved by NRND.

### Tally Sheets, Forms and Records

All Crown forest resources measured must be recorded on forms approved by NRND.

All scale returns must be sent to NRND in a timely manner. The company and NRND will agree on a transfer schedule. Where companies fail to forward scale returns on schedule, NRND may apply interest penalties on the volumes of Crown forest resources not processed.

### **Electronic Data Transfer**

Electronic data transfer is an economical method of transferring scaling returns directly from the company source to NRND's data management system. Scaling data passing through a company electronic transfer system must not be altered prior to transmission to the Crown. Any such data transfer system must be designed with safeguards for protecting the Crown's interests.

The current methods of electronic data transfer make use of:

• on line transfer

# • internet transfer

The timber sales manager sets the standards and approves the transfer procedure. The timber harvesting authority will define the schedule for the transfer of scale data (electronic or hard copy) to NRND from the company. Where companies fail to transmit scale returns on schedule, NRND may apply interest penalties on the volumes of Crown forest resources not processed.

# **Glossary of Terms**

**Butt Swell** – is excessive flair beyond the normal taper of the log on the end of the log originally attached to the stump.

**Catface** – a defect on the surface of a log resulting from a wound where healing has not re-established the normal cross-section of the log.

**Church Door** – a defect, caused by a ground fire, resulting in a tapered piece of wood missing from the butt end of a butt log.

**Crown Charges** – This means all prices, charges, fees, penalties, costs, expenses, interest and fines imposed.

**Check Scale** – This is a second scale or measurement undertaken by another proficient scaler. It is primarily used for comparing the work of other scalers to maintain a uniform level of performance and control human error associated with scaling.

**Heart Rot** – rot that is confined to the heartwood of the log. Usually originates in the living tree.

**Licensee** – A person or company to whom a Licence (Forest Management Licence Agreement, Timber Sale Agreement, or Timber Permit) has been granted.

**Operating Year** – This is a twelve month period commencing on the 1st day of April in any year and ending on the 31st day of March in the following year.

**Pipe Rot** - a hole that is produced by decay and runs through the centre of a log.

**Pocket Rot** – rot localized in small areas and generally forming rounded or lens-shaped cavities. Also known as honeycomb decay.

**Primary Forest Products** – These are obtained from a forest and consist of commercially valuable raw material. The material is usually roundwood and woodchips.

**Primary Wood Products** – These are obtained from the stem, limbs or cut tree and have commercial value.

**Punk Rot** - a soft, weak or spongy condition of the wood caused by decay.

**Rescale** – This is a second scale of a quantity of wood when parties are not in agreement as to the original or first scale.

**Scale Records** – These include but are not limited to: scale tallies, delivery ledgers, summaries, statements of the amount of timber measured, purchase records and payment records.

**Stumpage Values** – In this manual, the term means the Timber dues value, the Forest Renewal Charge, the Forest Protection Charge and any included applicable bid prices.

**Timber** – In this Manual, timber includes Crown forest resources that are fixed length, tree length and wood chip fibre.

**Tree Length** – This is a term used to describe a tree after it has been felled, limbed and topped.

**Undersize** – This is any material below the minimum diameters defined in the utilization standards of this Manual.

**Valid Licensed Scale** – This is a scale undertaken by the holder of a valid Scalers Licence.

### References

Canadian Standards Association. 2015. Scaling roundwood/measurement of woodchips, tree residues and byproducts, CSA 0302.1/0302.2-15. 109pp.

Manitoba Conservation. 1997. *Manual of Scaling Instructions in Metric Units*. 79 pp.

Mantioba Natural Resources. 1988. Forest use and Management Regulations. http://web2.gov.mb.ca/laws/regs/pdf/f150-227.88r.pdf 79pp

Ontario Ministry of Natural Resources. *Scaling Manual Third Edition* April 1, 2007. 139 pp.

The Forest Act. 1987. http://web2.gov.mb.ca/laws/statutes/ccsm/f150e.php

Weights and Measures Act. 1985. <a href="http://laws.justice.gc.ca/en/W-6/index.html">http://laws.justice.gc.ca/en/W-6/index.html</a>

 Table 1
 Table of Squared Numbers

$4^2 = 16$	$48^2 = 2304$
$6^2 = 36$	$50^2 = 2500$
$8^2 = 64$	$52^2 = 2704$
$10^2 = 100$	$54^2 = 2916$
$12^2 = 144$	$56^2 = 3136$
$14^2 = 196$	$58^2 = 3364$
$16^2 = 256$	$60^2 = 3600$
$18^2 = 324$	$62^2 = 3844$
$20^2 = 400$	$64^2 = 4096$
$22^2 = 484$	$66^2 = 4356$
$24^2 = 576$	$68^2 = 4624$
$26^2 = 676$	$70^2 = 4900$
$28^2 = 784$	$72^2 = 5184$
$30^2 = 900$	$74^2 = 5476$
$32^2 = 1024$	$76^2 = 5776$
$34^2 = 1156$	$78^2 = 6084$
$36^2 = 1296$	$80^2 = 6400$
$38^2 = 1444$	$82^2 = 6724$
$40^2 = 1600$	$84^2 = 7056$
$42^2 = 1764$	$86^2 = 7396$
$44^2 = 1936$	$88^2 = 7744$
$46^2 = 2116$	$90^2 = 8100$

Table 2 Area of a Circle in Square Metres (m²)

Diameter (cm)	Area (m²)	Diameter (cm)	Area (m²)
4.0	0.0013	66.0	0.3421
6.0	0.0028	68.0	0.3632
8.0	0.0050	70.0	0.3848
10.0	0.0079	72.0	0.4072
12.0	0.0113	74.0	0.4301
14.0	0.0154	76.0	0.4536
16.0	0.0201	78.0	0.4778
18.0	0.0254	80.0	0.5027
20.0	0.0314	82.0	0.5281
22.0	0.0380	84.0	0.5542
24.0	0.0452	86.0	0.5809
26.0	0.0531	88.0	0.6082
28.0	0.0616	90.0	0.6362
30.0	0.0707	92.0	0.6648
32.0	0.0804	94.0	0.6940
34.0	0.0908	96.0	0.7238
36.0	0.1018	98.0	0.7543
38.0	0.1134	100.0	0.7854
40.0	0.1257	102.0	0.8171
42.0	0.1385	104.0	0.8495
44.0	0.1521	106.0	0.8825
46.0	0.1662	108.0	0.9161
48.0	0.1810	110.0	0.9503
50.0	0.1963	112.0	0.9852
52.0	0.2124	114.0	1.0207
54.0	0.2290	116.0	1.0568
56.0	0.2463	118.0	1.0936
58.0	0.2642	120.0	1.1310
60.0	0.2827	122.0	1.1690
62 0	0.3019	124.0	1.2076
64.0	0.3217	126.0	1.2469
		128.0	1.2868

Table 3: Log Volume in Cubic Metres of Cylinders

DIAMETER											LENGT	H IN ME	TRES										
cm	0.9	1.1	1.3	1.5	1.7	1.9	2.1	2.3	2.5	2.7	2.9	3.1	3.3	3.5	3.7	3.9	4.1	4.3	4.5	4.7	4.9	5.1	5.3
4	0.001	0.001	0.002	0.002	0.002	0.002	0.003	0.003	0.003	0.003	0.004	0.004	0.004	0.004	0.005	0.005	0.005	0.005	0.006	0.006	0.006	0.006	0.007
6	0.003	0.003	0.004	0.004	0.005	0.005	0.006	0.007	0.007	0.008	0.008	0.009	0.009	0.010	0.010	0.011	0.012	0.012	0.013	0.013	0.014	0.014	0.015
8	0.005	0.006	0.007	0.008	0.009	0.010	0.011	0.012	0.013	0.014	0.015	0.016	0.017	0.018	0.019	0.020	0.021	0.022	0.023	0.024	0.025	0.026	0.027
10	0.007	0.009	0.010	0.012	0.013	0.015	0.016	0.018	0.020	0.021	0.023	0.024	0.026	0.027	0.029	0.031	0.032	0.034	0.035	0.037	0.038	0.040	0.042
12	0.010	0.012	0.015	0.017	0.019	0.021	0.024	0.026	0.028	0.031	0.033	0.035	0.037	0.040	0.042	0.044	0.046	0.049	0.051	0.053	0.055	0.058	0.060
14	0.014	0.017	0.020	0.023	0.026	0.029	0.032	0.035	0.038	0.042	0.045	0.048	0.051	0.054	0.057	0.060	0.063	0.066	0.069	0.072	0.075	0.079	0.082
16	0.018	0.022	0.026	0.030	0.034	0.038	0.042	0.046	0.050	0.054	0.058	0.062	0.066	0.070	0.074	0.078	0.082	0.086	0.090	0.094	0.099	0.103	0.107
18	0.023	0.028	0.033	0.038	0.043	0.048	0.053	0.059	0.064	0.069	0.074	0.079	0.084	0.089	0.094	0.099	0.104	0.109	0.115	0.120	0.125	0.130	0.135
20	0.028	0.035	0.041	0.047	0.053	0.060	0.066	0.072	0.079	0.085	0.091	0.097	0.104	0.110	0.116	0.123	0.129	0.135	0.141	0.148	0.154	0.160	0.167
22	0.034	0.042	0.049	0.057	0.065	0.072	0.080	0.087	0.095	0.103	0.110	0.118	0.125	0.133	0.141	0.148	0.156	0.163	0.171	0.179	0.186	0.194	0.201
24	0.041	0.050	0.059	0.068	0.077	0.086	0.095	0.104	0.113	0.122	0.131	0.140	0.149	0.158	0.167	0.176	0.185	0.195	0.204	0.213	0.222	0.231	0.240
26	0.048	0.058	0.069	0.080	0.090	0.101	0.111	0.122	0.133	0.143	0.154	0.165	0.175	0.186	0.196	0.207	0.218	0.228	0.239	0.250	0.260	0.271	0.281
28	0.055	0.068	0.080	0.092	0.105	0.117	0.129	0.142	0.154	0.166	0.179	0.191	0.203	0.216	0.228	0.240	0.252	0.265	0.277	0.289	0.302	0.314	0.326
30	0.064	0.078	0.092	0.106	0.120	0.134	0.148	0.163	0.177	0.191	0.205	0.219	0.233	0.247	0.262	0.276	0.290	0.304	0.318	0.332	0.346	0.360	0.375
32	0.072	0.088	0.105	0.121	0.137	0.153	0.169	0.185	0.201	0.217	0.233	0.249	0.265	0.281	0.298	0.314	0.330	0.346	0.362	0.378	0.394	0.410	0.426
34	0.082	0.100	0.118	0.136	0.154	0.173	0.191	0.209	0.227	0.245	0.263	0.281	0.300	0.318	0.336	0.354	0.372	0.390	0.409	0.427	0.445	0.463	0.481
36	0.092	0.112	0.132	0.153	0.173	0.193	0.214	0.234	0.254	0.275	0.295	0.316	0.336	0.356	0.377	0.397	0.417	0.438	0.458	0.478	0.499	0.519	0.539
38	0.102	0.125	0.147	0.170	0.193	0.215	0.238	0.261	0.284	0.306	0.329	0.352	0.374	0.397	0.420	0.442	0.465	0.488	0.510	0.533	0.556	0.578	0.601
40	0.113	0.138	0.163	0.188	0.214	0.239	0.264	0.289	0.314	0.339	0.364	0.390	0.415	0.440	0.465	0.490	0.515	0.540	0.565	0.591	0.616	0.641	0.666
42	0.125	0.152	0.180	0.208	0.236	0.263	0.291	0.319	0.346	0.374	0.402	0.429	0.457	0.485	0.513	0.540	0.568	0.596	0.623	0.651	0.679	0.707	0.734
44	0.137	0.167	0.198	0.228	0.258	0.289	0.319	0.350	0.380	0.411	0.441	0.471	0.502	0.532	0.563	0.593	0.623	0.654	0.684	0.715	0.745	0.775	0.806
46	0.150	0.183	0.216	0.249	0.283	0.316	0.349	0.382	0.415	0.449	0.482	0.515	0.548	0.582	0.615	0.648	0.681	0.715	0.748	0.781	0.814	0.848	0.881
48	0.163	0.199	0.235	0.271	0.308	0.344	0.380	0.416	0.452	0.489	0.525	0.561	0.597	0.633	0.670	0.706	0.742	0.778	0.814	0.850	0.887	0.923	0.959
50	0.177	0.216	0.255	0.295	0.334	0.373	0.412	0.452	0.491	0.530	0.569	0.609	0.648	0.687	0.726	0.766	0.805	0.844	0.884	0.923	0.962	1.001	1.041
52	0.191	0.234	0.276	0.319	0.361	0.404	0.446	0.488	0.531	0.573	0.616	0.658	0.701	0.743	0.786	0.828	0.871	0.913	0.956	0.998	1.041	1.083	1.126
54	0.206	0.252	0.298	0.344	0.389	0.435	0.481	0.527	0.573	0.618	0.664	0.710	0.756	0.802	0.847	0.893	0.939	0.985	1.031	1.076	1.122	1.168	1.214
56	0.222	0.271	0.320	0.369	0.419	0.468	0.517	0.566	0.616	0.665	0.714	0.764	0.813	0.862	0.911	0.961	1.010	1.059	1.108	1.158	1.207	1.256	1.305
58	0.238	0.291	0.343	0.396	0.449	0.502	0.555	0.608	0.661	0.713	0.766	0.819	0.872	0.925	0.978	1.030	1.083	1.136	1.189	1.242	1.295	1.347	1.400
60	0.254	0.311	0.368	0.424	0.481	0.537	0.594	0.650	0.707	0.763	0.820	0.877	0.933	0.990	1.046	1.103	1.159	1.216	1.272	1.329	1.385	1.442	1.499
62	0.272	0.332	0.392	0.453	0.513	0.574	0.634	0.694	0.755	0.815	0.876	0.936	0.996	1.057	1.117	1.177	1.238	1.298	1.359	1.419	1.479	1.540	1.600
64	0.290	0.354	0.418	0.483	0.547	0.611	0.676	0.740	0.804	0.869	0.933	0.997	1.062	1.126	1.190	1.255	1.319	1.383	1.448	1.512	1.576	1.641	1.705

Table 3: Log Volume in Cubic Metres of Cylinders

DIAMETER											LENGT	H IN ME	TRES										
cm	0.9	1.1	1.3	1.5	1.7	1.9	2.1	2.3	2.5	2.7	2.9	3.1	3.3	3.5	3.7	3.9	4.1	4.3	4.5	4.7	4.9	5.1	5.3
66	0.308	0.376	0.445	0.513	0.582	0.650	0.718	0.787	0.855	0.924	0.992	1.061	1.129	1.197	1.266	1.334	1.403	1.471	1.540	1.608	1.676	1.745	1.813
68	0.327	0.399	0.472	0.545	0.617	0.690	0.763	0.835	0.908	0.981	1.053	1.126	1.198	1.271	1.344	1.416	1.489	1.562	1.634	1.707	1.780	1.852	1.925
70	0.346	0.423	0.500	0.577	0.654	0.731	0.808	0.885	0.962	1.039	1.116	1.193	1.270	1.347	1.424	1.501	1.578	1.655	1.732	1.809	1.886	1.963	2.040
72	0.366	0.448	0.529	0.611	0.692	0.774	0.855	0.936	1.018	1.099	1.181	1.262	1.344	1.425	1.506	1.588	1.669	1.751	1.832	1.914	1.995	2.076	2.158
74	0.387	0.473	0.559	0.645	0.731	0.817	0.903	0.989	1.075	1.161	1.247	1.333	1.419	1.505	1.591	1.677	1.763	1.849	1.935	2.021	2.107	2.193	2.279
76	0.408	0.499	0.590	0.680	0.771	0.862	0.953	1.043	1.134	1.225	1.316	1.406	1.497	1.588	1.678	1.769	1.860	1.951	2.041	2.132	2.223	2.314	2.404
78	0.430	0.526	0.621	0.717	0.812	0.908	1.003	1.099	1.195	1.290	1.386	1.481	1.577	1.672	1.768	1.864	1.959	2.055	2.150	2.246	2.341	2.437	2.533
80	0.452	0.553	0.653	0.754	0.855	0.955	1.056	1.156	1.257	1.357	1.458	1.558	1.659	1.759	1.860	1.960	2.061	2.161	2.262	2.362	2.463	2.564	2.664
82	0.475	0.581	0.687	0.792	0.898	1.003	1.109	1.215	1.320	1.426	1.531	1.637	1.743	1.848	1.954	2.060	2.165	2.271	2.376	2.482	2.588	2.693	2.799
84	0.499	0.610	0.720	0.831	0.942	1.053	1.164	1.275	1.385	1.496	1.607	1.718	1.829	1.940	2.050	2.161	2.272	2.383	2.494	2.605	2.715	2.826	2.937
86	0.523	0.639	0.755	0.871	0.987	1.104	1.220	1.336	1.452	1.568	1.685	1.801	1.917	2.033	2.149	2.265	2.382	2.498	2.614	2.730	2.846	2.962	3.079
88	0.547	0.669	0.791	0.912	1.034	1.156	1.277	1.399	1.521	1.642	1.764	1.885	2.007	2.129	2.250	2.372	2.494	2.615	2.737	2.859	2.980	3.102	3.224
90	0.573	0.700	0.827	0.954	1.081	1.209	1.336	1.463	1.590	1.718	1.845	1.972	2.099	2.227	2.354	2.481	2.608	2.736	2.863	2.990	3.117	3.244	3.372
92	0.598	0.731	0.864	0.997	1.130	1.263	1.396	1.529	1.662	1.795	1.928	2.061	2.194	2.327	2.460	2.593	2.726	2.858	2.991	3.124	3.257	3.390	3.523
94	0.625	0.763	0.902	1.041	1.180	1.319	1.457	1.596	1.735	1.874	2.013	2.151	2.290	2.429	2.568	2.707	2.845	2.984	3.123	3.262	3.400	3.539	3.678
96	0.651	0.796	0.941	1.086	1.230	1.375	1.520	1.665	1.810	1.954	2.099	2.244	2.389	2.533	2.678	2.823	2.968	3.112	3.257	3.402	3.547	3.691	3.836
98	0.679	0.830	0.981	1.131	1.282	1.433	1.584	1.735	1.886	2.037	2.187	2.338	2.489	2.640	2.791	2.942	3.093	3.243	3.394	3.545	3.696	3.847	3.998
100	0.707	0.864	1.021	1.178	1.335	1.492	1.649	1.806	1.963	2.121	2.278	2.435	2.592	2.749	2.906	3.063	3.220	3.377	3.534	3.691	3.848	4.006	4.163
102	0.735	0.899	1.062	1.226	1.389	1.553	1.716	1.879	2.043	2.206	2.370	2.533	2.697	2.860	3.023	3.187	3.350	3.514	3.677	3.840	4.004	4.167	4.331
104	0.765	0.934	1.104	1.274	1.444	1.614	1.784	1.954	2.124	2.294	2.464	2.633	2.803	2.973	3.143	3.313	3.483	3.653	3.823	3.993	4.162	4.332	4.502
106	0.794	0.971	1.147	1.324	1.500	1.677	1.853	2.030	2.206	2.383	2.559	2.736	2.912	3.089	3.265	3.442	3.618	3.795	3.971	4.148	4.324	4.501	4.667
108	0.824	1.008	1.191	1.374	1.557	1.741	1.924	2.107	2.290	2.473	2.657	2.840	3.023	3.206	3.390	3.573	3.756	3.939	4.122	4.306	4.489	4.672	4.855
110	0.855	1.045	1.235	1.425	1.616	1.806	1.996	2.186	2.376	2.566	2.756	2.946	3.136	3.326	3.516	3.706	3.896	4.086	4.276	4.467	4.657	4.847	5.037
112	0.887	1.084	1.281	1.478	1.675	1.872	2.069	2.266	2.463	2.660	2.857	3.054	3.251	3.448	3.645	3.842	4.039	4.236	4.433	4.630	4.827	5.025	5.222
114	0.919	1.123	1.327	1.531	1.735	1.939	2.143	2.348	2.552	2.756	2.960	3.164	3.368	3.572	3.777	3.981	4.185	4.389	4.593	4.797	5.001	5.206	5.410

Table 3: Log Volume in Cubic Metres of Cylinders

DIAMETER										LE	NGTH I	N METR	ES									
cm	5.5	5.7	5.9	6.1	6.3	6.5	6.7	6.9	7.1	7.3	7.5	7.7	7.9	8.1	8.3	8.5	8.7	8.9	9.1	9.3	9.5	9.7
4	0.007	0.007	0.007	0.008	0.008	0.008	0.008	0.009	0.009	0.009	0.009	0.010	0.010	0.010	0.010	0.011	0.011	0.011	0.011	0.012	0.012	0.012
6	0.016	0.016	0.017	0.017	0.018	0.018	0.018	0.020	0.020	0.021	0.021	0.022	0.022	0.023	0.023	0.024	0.025	0.025	0.026	0.026	0.027	0.027
8	0.028	0.029	0.030	0.031	0.032	0.033	0.034	0.035	0.036	0.037	0.038	0.039	0.040	0.041	0.042	0.043	0.044	0.045	0.046	0.047	0.048	0.049
10	0.043	0.045	0.046	0.048	0.049	0.051	0.053	0.054	0.056	0.057	0.059	0.060	0.062	0.064	0.065	0.067	0.068	0.070	0.071	0.073	0.075	0.076
12	0.062	0.064	0.067	0.069	0.071	0.074	0.076	0.078	0.080	0.083	0.085	0.087	0.089	0.092	0.094	0.096	0.098	0.101	0.103	0.105	0.107	0.110
14	0.085	0.088	0.091	0.094	0.097	0.100	0.103	0.106	0.109	0.112	0.115	0.119	0.122	0.125	0.128	0.131	0.134	0.137	0.140	0.143	0.146	0.149
16	0.111	0.115	0.119	0.123	0.127	0.131	0.135	0.139	0.143	0.147	0.151	0.155	0.159	0.163	0.167	0.171	0.175	0.179	0.183	0.187	0.191	0.195
18	0.140	0.145	0.150	0.155	0.160	0.165	0.170	0.176	0.181	0.186	0.191	0.196	0.201	0.206	0.211	0.216	0.221	0.226	0.232	0.237	0.242	0.247
20	0.173	0.179	0.185	0.192	0.198	0.204	0.210	0.217	0.223	0.229	0.236	0.242	0.248	0.254	0.261	0.267	0.273	0.280	0.286	0.292	0.298	0.305
22	0.209	0.217	0.224	0.232	0.239	0.247	0.255	0.262	0.270	0.277	0.385	0.293	0.300	0.308	0.316	0.323	0.331	0.338	0.346	0.354	0.361	0.369
24	0.249	0.258	0.267	0.276	0.285	0.294	0.303	0.312	0.321	0.330	0.339	0.348	0.357	0.366	0.375	0.385	0.394	0.403	0.412	0.421	0.430	0.439
26	0.292	0.303	0.313	0.324	0.334	0.345	0.356	0.366	0.377	0.388	0.398	0.409	0.419	0.430	0.441	0.451	0.462	0.473	0.483	0.494	0.504	0.515
28	0.339	0.351	0.363	0.376	0.388	0.400	0.413	0.425	0.437	0.449	0.462	0.474	0.486	0.499	0.511	0.523	0.536	0.548	0.560	0.573	0.585	0.597
30	0.389	0.403	0.417	0.431	0.445	0.459	0.474	0.488	0.502	0.516	0.530	0.544	0.558	0.573	0.587	0.601	0.615	0.629	0.643	0.657	0.672	0.686
32	0.442	0.458	0.475	0.491	0.507	0.523	0.539	0.555	0.571	0.587	0.603	0.619	0.635	0.651	0.668	0.684	0.700	0.716	0.732	0.748	0.764	0.780
34	0.499	0.518	0.536	0.554	0.572	0.590	0.608	0.626	0.645	0.663	0.681	0.699	0.717	0.735	0.754	0.772	0.790	0.808	0.826	0.844	0.863	0.881
36	0.560	0.580	0.601	0.621	0.641	0.662	0.682	0.702	0.723	0.743	0.763	0.784	0.804	0.824	0.845	0.865	0.886	0.906	0.926	0.947	0.967	0.987
38	0.624	0.646	0.669	0.692	0.714	0.737	0.760	0.783	0.805	0.828	0.851	0.873	0.896	0.919	0.941	0.964	0.987	1.009	1.032	1.055	1.077	1.100
40	0.691	0.716	0.741	0.767	0.792	0.817	0.842	0.867	0.892	0.917	0.942	0.968	0.993	1.018	1.043	1.068	1.093	1.118	1.144	1.169	1.194	1.219
42	0.762	0.790	0.817	0.845	0.873	0.901	0.928	0.956	0.984	1.011	1.039	1.067	1.094	1.122	1.150	1.178	1.205	1.233	1.261	1.288	1.316	1.344
44	0.836	0.867	0.897	0.928	0.958	0.988	1.019	1.049	1.080	1.110	1.140	1.171	1.201	1.232	1.262	1.292	1.323	1.353	1.384	1.414	1.445	1.475
46	0.914	0.947	0.981	1.014	1.047	1.080	1.113	1.147	1.180	1.213	1.246	1.280	1.313	1.346	1.379	1.413	1.446	1.479	1.512	1.546	1.579	1.612
48	0.995	1.031	1.068	1.104	1.140	1.176	1.212	1.249	1.285	1.321	1.357	1.393	1.430	1.466	1.502	1.538	1.574	1.611	1.647	1.683	1.719	1.755
50	1.080	1.119	1.158	1.198	1.237	1.276	1.316	1.355	1.394	1.433	1.473	1.512	1.551	1.590	1.630	1.669	1.708	1.748	1.787	1.826	1.865	1.905
52	1.168	1.211	1.253	1.295	1.338	1.380	1.423	1.465	1.508	1.550	1.593	1.635	1.678	1.720	1.763	1.805	1.848	1.890	1.933	1.975	2.018	2.060
54	1.260	1.305	1.351	1.397	1.443	1.489	1.534	1.580	1.626	1.672	1.718	1.763	1.809	1.855	1.901	1.947	1.992	2.038	2.084	2.130	2.176	2.222
56	1.355	1.404	1.453	1.502	1.552	1.601	1.650	1.699	1.749	1.798	1.847	1.897	1.946	1.995	2.044	2.094	2.143	2.192	2.241	2.291	2.340	2.389
58	1.453	1.506	1.559	1.612	1.665	1.717	1.770	1.823	1.876	1.929	1.982	2.034	2.087	2.140	2.193	2.246	2.299	2.351	2.404	2.457	2.510	2.563
60	1.555	1.612	1.668	1.725	1.781	1.838	1.894	1.951	2.007	2.064	2.121	2.177	2.234	2.290	2.347	2.403	2.460	2.516	2.573	2.630	2.686	2.743
62	1.660	1.721	1.781	1.842	1.902	1.962	2.023	2.083	2.144	2.204	2.264	2.325	2.385	2.445	2.506	2.566	2.627	2.687	2.747	2.808	2.868	2.928
64	1.769	1.834	1.898	1.962	2.027	2.091	2.155	2.220	2.284	2.348	2.413	2.477	2.541	2.606	2.670	2.734	2.799	2.863	2.927	2.992	3.056	3.120

Table 3:	Log	Volu	ne in	Cubi	c Met	res of	f Cylii	nders	i													
DIAMETER										LE	NGTH I	N METR	ES									
cm	5.5	5.7	5.9	6.1	6.3	6.5	6.7	6.9	7.1	7.3	7.5	7.7	7.9	8.1	8.3	8.5	8.7	8.9	9.1	9.3	9.5	9.7
66	1.882	1.950	2.019	2.087	2.155	2.224	2.292	2.361	2.429	2.497	2.566	2.634	2.703	2.771	2.840	2.908	2.976	3.045	3.113	3.182	3.250	3.319
68	1.997	2.070	2.143	2.215	2.288	2.361	2.433	2.506	2.578	2.651	2.724	2.796	2.869	2.942	3.014	3.087	3.160	3.232	3.305	3.377	3.450	3.523
70	2.117	2.194	2.271	2.348	2.425	2.501	2.578	2.655	2.732	2.809	2.886	2.963	3.040	3.117	3.194	3.271	3.348	3.425	3.502	3.579	3.656	3.733
72	2.239	2.321	2.402	2.484	2.565	2.646	2.728	2.809	2.891	2.972	3.054	3.135	3.216	3.298	3.379	3.461	3.542	3.624	3.705	3.786	3.868	3.949
74	2.365	2.451	2.537	2.624	2.710	2.796	2.882	2.968	3.054	3.140	3.226	3.312	3.398	3.484	3.570	3.656	3.742	3.828	3.914	4.000	4.086	4.172
76	2.495	2.586	2.677	2.767	2.858	2.949	3.039	3.130	3.221	3.312	3.402	3.493	3.584	3.675	3.765	3.856	3.947	4.037	4.128	4.219	4.310	4.400
78	2.628	2.724	2.819	2.915	3.010	3.106	3.201	3.297	3.393	3.488	3.584	3.679	3.775	3.870	3.966	4.062	4.157	4.253	4.348	4.444	4.539	4.635
80	2.765	2.865	2.966	3.066	3.167	3.267	3.368	3.468	3.569	3.669	3.770	3.870	3.971	4.071	4.172	4.273	4.373	4.474	4.574	4.675	4.775	4.876
82	2.905	3.010	3.116	3.221	3.327	3.433	3.538	3.644	3.750	3.855	3.961	4.066	4.172	4.278	4.383	4.489	4.594	4.700	4.806	4.911	5.017	5.123
84	3.048	3.159	3.270	3.380	3.491	3.602	3.713	3.824	3.935	4.045	4.156	4.267	4.378	4.489	4.600	4.710	4.821	4.932	5.043	5.154	5.265	5.376
86	3.195	3.311	3.427	3.543	3.660	3.776	3.892	4.008	4.124	4.240	4.357	4.473	4.589	4.705	4.821	4.937	5.054	5.170	5.286	5.402	5.518	5.635
88	3.345	3.467	3.588	3.710	3.832	3.953	4.075	4.197	4.318	4.440	4.562	4.683	4.805	4.927	5.048	5.170	5.291	5.413	5.535	5.656	5.778	5.900
90	3.499	3.626	3.753	3.881	4.008	4.135	4.262	4.390	4.517	4.644	4.771	4.899	5.026	5.153	5.280	5.407	5.535	5.662	5.789	5.916	6.044	6.171
92	3.656	3.789	3.922	4.055	4.188	4.321	4.454	4.587	4.720	4.853	4.986	5.119	5.252	5.385	5.518	5.650	5.783	5.916	6.049	6.182	6.315	6.448
94	3.817	3.956	4.094	4.233	4.327	4.511	4.650	4.788	4.927	5.066	5.205	5.344	5.482	5.621	5.760	5.899	6.038	6.176	6.315	6.454	6.593	6.732
96	3.981	4.126	4.271	4.415	4.560	4.705	4.850	4.944	5.139	5.284	5.429	5.573	5.718	5.863	6.008	6.152	6.297	6.442	6.587	6.732	6.876	7.021
98	4.149	4.299	4.450	4.601	4.752	4.903	5.054	5.205	5.355	5.506	5.657	5.808	5.959	6.110	6.261	6.412	6.562	6.713	6.864	7.015	7.166	7.317
100	4.320	4.477	4.634	4.791	4.948	5.105	5.262	5.419	5.576	5.733	5.890	6.048	6.205	6.362	6.519	6.676	6.833	6.990	7.147	7.304	7.461	7.618
102	4.494	4.658	4.821	4.984	5.148	5.311	5.475	5.638	5.802	5.965	6.128	6.292	6.455	6.619	6.782	6.946	7.109	7.272	7.436	7.599	7.763	7.926
104	4.672	4.842	5.012	5.182	5.352	5.522	5.692	5.861	6.031	6.201	6.371	6.541	6.711	6.881	7.051	7.221	7.391	7.560	7.730	7.900	8.070	8.240
106	4.854	5.030	5.207	5.383	5.560	5.736	5.913	6.089	6.266	6.442	6.619	6.795	6.972	7.148	7.325	7.501	7.678	7.854	8.030	8.207	8.383	8.560
108	5.038	5.222	5.405	5.588	5.771	5.955	6.138	6.321	6.504	6.687	6.871	7.054	7.237	7.420	7.604	7.787	7.970	8.153	8.336	8.520	8.703	8.886
110	5.227	5.417	5.607	5.797	5.987	6.177	6.367	6.557	6.747	6.937	7.127	7.318	7.508	7.698	7.888	8.078	8.268	8.458	8.648	8.838	9.028	9.218
112	5.419	5.616	5.813	6.010	6.207	6.404	6.601	6.798	6.995	7.192	7.389	7.586	7.783	7.980	8.177	8.374	8.571	8.768	8.965	9.162	9.359	9.556

114

5.614 5.818

6.022

6.226

6.430

6.839

6.635

7.043 7.247 7.451 7.655

7.859

8.064

8.268

8.472 8.676

8.880

9.084

9.288

9.493

9.697

9.901

**Table 4: Log Volume in Cubic Metres of Tapering Cylinders** 

DIAMETER (small end)											LENG	ГН ІМ М	ETRES										
cm	0.9	1.1	1.3	1.5	1.7	1.9	2.1	2.3	2.5	2.7	2.9	3.1	3.3	3.5	3.7	3.9	4.1	4.3	4.5	4.7	4.9	5.1	5.3
4	0.001	0.002	0.002	0.003	0.003	0.004	0.004	0.005	0.005	0.006	0.007	0.007	0.008	0.009	0.010	0.011	0.012	0.013	0.014	0.015	0.016	0.017	0.018
6	0.003	0.004	0.005	0.005	0.006	0.007	0.008	0.009	0.010	0.011	0.013	0.014	0.015	0.017	0.018	0.019	0.021	0.022	0.024	0.026	0.027	0.029	0.031
8	0.005	0.006	0.008	0.009	0.010	0.012	0.014	0.015	0.017	0.019	0.020	0.022	0.024	0.026	0.028	0.030	0.033	0.035	0.037	0.040	0.042	0.045	0.047
10	0.008	0.010	0.012	0.014	0.016	0.018	0.020	0.022	0.025	0.027	0.030	0.032	0.035	0.038	0.041	0.044	0.047	0.050	0.053	0.056	0.060	0.063	0.067
12	0.011	0.014	0.016	0.019	0.022	0.025	0.028	0.031	0.034	0.038	0.041	0.045	0.048	0.052	0.056	0.060	0.064	0.068	0.072	0.076	0.080	0.085	0.089
14	0.015	0.018	0.022	0.026	0.029	0.033	0.037	0.041	0.046	0.050	0.054	0.059	0.063	0.068	0.073	0.078	0.083	0.088	0.093	0.099	0.104	0.110	0.115
16	0.019	0.024	0.028	0.033	0.038	0.043	0.048	0.053	0.058	0.064	0.069	0.075	0.081	0.087	0.093	0.099	0.105	0.111	0.118	0.124	0.131	0.138	0.145
18	0.024	0.030	0.036	0.041	0.047	0.054	0.060	0.066	0.073	0.079	0.086	0.093	0.100	0.107	0.115	0.122	0.129	0.137	0.145	0.153	0.161	0.169	0.178
20	0.030	0.036	0.044	0.051	0.058	0.065	0.073	0.081	0.089	0.097	0.105	0.113	0.121	0.130	0.139	0.148	0.157	0.166	0.175	0.184	0.194	0.204	0.214
22	0.036	0.044	0.052	0.061	0.070	0.079	0.088	0.097	0.106	0.116	0.125	0.135	0.145	0.155	0.165	0.176	0.186	0.197	0.208	0.219	0.230	0.241	0.253
24	0.042	0.052	0.062	0.072	0.082	0.093	0.103	0.114	0.125	0.136	0.148	0.159	0.171	0.182	0.194	0.206	0.219	0.231	0.244	0.256	0.269	0.282	0.296
26	0.049	0.061	0.073	0.084	0.096	0.108	0.121	0.133	0.146	0.159	0.172	0.185	0.198	0.212	0.225	0.239	0.253	0.268	0.282	0.297	0.311	0.326	0.342
28	0.057	0.070	0.084	0.097	0.111	0.125	0.139	0.153	0.168	0.183	0.198	0.213	0.228	0.243	0.259	0.275	0.291	0.307	0.323	0.340	0.357	0.374	0.391
30	0.066	0.081	0.096	0.111	0.127	0.143	0.159	0.175	0.192	0.208	0.225	0.242	0.260	0.277	0.295	0.313	0.331	0.349	0.368	0.386	0.405	0.424	0.444
32	0.074	0.092	0.109	0.126	0.144	0.162	0.180	0.199	0.217	0.236	0.255	0.274	0.293	0.313	0.333	0.353	0.373	0.394	0.415	0.436	0.457	0.478	0.500
34	0.084	0.103	0.123	0.142	0.162	0.182	0.203	0.223	0.244	0.265	0.286	0.308	0.329	0.351	0.373	0.396	0.418	0.441	0.464	0.488	0.511	0.535	0.559
36	0.094	0.115	0.137	0.159	0.181	0.204	0.226	0.249	0.272	0.296	0.319	0.343	0.367	0.392	0.416	0.441	0.466	0.492	0.517	0.543	0.569	0.595	0.622
38	0.105	0.128	0.153	0.177	0.202	0.226	0.252	0.277	0.302	0.328	0.354	0.381	0.407	0.434	0.461	0.489	0.517	0.544	0.573	0.601	0.630	0.659	0.688
40	0.116	0.142	0.169	0.196	0.223	0.250	0.278	0.306	0.334	0.363	0.391	0.420	0.450	0.479	0.509	0.539	0.569	0.600	0.631	0.662	0.693	0.725	0.757
42	0.127	0.156	0.186	0.215	0.245	0.275	0.306	0.336	0.367	0.399	0.430	0.462	0.494	0.526	0.559	0.592	0.625	0.658	0.692	0.726	0.760	0.795	0.830
44	0.140	0.171	0.204	0.236	0.269	0.302	0.335	0.368	0.402	0.436	0.470	0.505	0.540	0.575	0.611	0.647	0.683	0.719	0.756	0.793	0.830	0.868	0.906
46	0.153	0.187	0.222	0.257	0.293	0.329	0.365	0.402	0.438	0.475	0.513	0.550	0.588	0.627	0.665	0.704	0.743	0.783	0.823	0.863	0.903	0.944	0.985
48	0.166	0.204	0.242	0.280	0.319	0.358	0.397	0.436	0.476	0.516	0.557	0.598	0.639	0.680	0.722	0.764	0.807	0.849	0.892	0.936	0.980	1.024	1.068
50	0.180	0.221	0.262	0.303	0.345	0.387	0.430	0.473	0.516	0.559	0.603	0.647	0.691	0.736	0.781	0.827	0.872	0.918	0.965	1.012	1.059	1.106	1.154
52	0.194	0.239	0.283	0.328	0.373	0.418	0.464	0.510	0.557	0.604	0.651	0.698	0.746	0.794	0.843	0.892	0.941	0.990	1.040	1.090	1.141	1.192	1.243
54	0.210	0.257	0.305	0.353	0.402	0.451	0.500	0.549	0.599	0.650	0.700	0.751	0.803	0.854	0.906	0.959	1.012	1.065	1.118	1.172	1.226	1.281	1.336
56	0.225	0.276	0.328	0.379	0.432	0.484	0.537	0.590	0.644	0.697	0.752	0.806	0.861	0.917	0.973	1.029	1.085	1.142	1.199	1.257	1.315	1.373	1.432
58	0.241	0.296	0.351	0.407	0.462	0.519	0.575	0.632	0.689	0.747	0.805	0.863	0.922	0.981	1.041	1.101	1.161	1.222	1.283	1.344	1.406	1.469	1.531
60 62	0.258	0.317	0.376	0.435	0.494	0.554	0.615	0.675	0.737	0.798	0.860	0.922	0.985	1.048	1.112	1.176	1.240	1.304	1.370	1.435	1.501	1.567	1.634
64	0.276 0.294	0.338	0.401 0.427	0.464	0.527	0.591	0.656	0.720	0.786	0.851	0.917	0.983	1.050	1.117	1.185	1.253	1.321	1.390	1.459	1.529	1.599	1.669	1.740 1.849
66	0.294	0.360	0.427	0.494	0.562 0.597	0.630 0.669	0.698 0.741	0.767 0.815	0.836	0.906 0.962	0.976 1.036	1.046	1.117	1.188 1.262	1.260 1.338	1.332	1.405 1.491	1.478 1.569	1.551 1.646	1.625 1.725	1.699 1.803	1.774 1.882	1.962
68	0.312	0.406	0.434	0.557	0.633	0.709	0.741	0.864	0.942	1.020	1.099	1.178	1.257	1.337	1.418	1.499	1.580	1.662	1.744	1.827	1.910	1.994	2.078
70	0.351	0.430	0.510	0.590	0.670	0.751	0.788	0.914	0.942	1.080	1.163	1.246	1.331	1.415	1.500	1.586	1.672	1.758	1.845	1.932	2.020	2.108	2.197
72	0.371	0.455	0.539	0.624	0.709	0.794	0.880	0.967	1.054	1.141	1.229	1.317	1.406	1.495	1.585	1.675	1.766	1.857	1.948	2.041	2.133	2.226	2.320
74	0.392	0.480	0.569	0.658	0.748	0.838	0.929	1.020	1.112	1.204	1.297	1.390	1.483	1.577	1.672	1.767	1.862	1.958	2.055	2.152	2.249	2.347	2.446
76	0.392	0.506	0.600	0.694	0.748	0.884	0.979	1.020	1.172	1.269	1.366	1.464	1.563	1.662	1.761	1.861	1.962	2.063	2.164	2.132	2.368	2.471	2.575
78	0.415	0.533	0.632	0.094	0.769	0.930	1.031	1.132	1.233	1.335	1.438	1.541	1.644	1.748	1.853	1.958	2.063	2.170	2.104	2.383	2.491	2.599	2.708
80	0.457	0.561	0.664	0.768	0.873	0.930	1.083	1.190	1.296	1.403	1.511	1.619	1.728	1.837	1.947	2.057	2.168	2.170	2.391	2.503	2.616	2.730	2.843
82	0.481	0.589	0.697	0.807	0.916	1.027	1.138	1.249	1.361	1.473	1.586	1.700	1.814	1.928	2.043	2.159	2.275	2.391	2.509	2.626	2.745	2.863	2.983
84	0.504	0.618	0.732	0.846	0.961	1.077	1.193	1.310	1.427	1.545	1.663	1.782	1.901	2.021	2.142	2.263	2.384	2.507	2.629	2.752	2.876	3.000	3.125
04	0.304	0.010	0.732	0.040	0.301	1.077	1.133	1.510	1.741	1.545	1.003	1.702	1.301	2.021	2.142	2.203	2.304	2.307	2.023	2.132	2.070	5.000	0.120

Table 4: Log Volume in Cubic Metres of Tapering Cylinders

DIAMETER (small end)											LENG	ГН ІМ М	ETRES										
cm	0.9	1.1	1.3	1.5	1.7	1.9	2.1	2.3	2.5	2.7	2.9	3.1	3.3	3.5	3.7	3.9	4.1	4.3	4.5	4.7	4.9	5.1	5.3
86	0.528	0.647	0.767	0.887	1.007	1.128	1.250	1.372	1.495	1.618	1.742	1.866	1.991	2.117	2.243	2.369	2.497	2.624	2.753	2.881	3.011	3.141	3.271
88	0.553	0.677	0.802	0.928	1.054	1.181	1.308	1.436	1.564	1.693	1.822	1.952	2.083	2.214	2.346	2.478	2.611	2.745	2.879	3.013	3.148	3.284	3.421
90	0.578	0.708	0.839	0.970	1.102	1.234	1.367	1.501	1.635	1.770	1.905	2.041	2.177	2.314	2.452	2.590	2.728	2.868	3.008	3.148	3.289	3.431	3.573
92	0.604	0.740	0.876	1.013	1.151	1.289	1.428	1.567	1.707	1.848	1.989	2.131	2.273	2.416	2.560	2.704	2.848	2.994	3.140	3.286	3.433	3.581	3.729
94	0.631	0.772	0.915	1.058	1.201	1.345	1.490	1.635	1.781	1.928	2.075	2.223	2.371	2.520	2.670	2.820	2.971	3.122	3.274	3.427	3.580	3.734	3.888
96	0.658	0.805	0.954	1.103	1.252	1.403	1.553	1.705	1.857	2.010	2.163	2.317	2.471	2.627	2.782	2.939	3.096	3.253	3.412	3.571	3.730	3.890	4.051
98	0.685	0.839	0.994	1.149	1.305	1.461	1.618	1.776	1.934	2.093	2.253	2.413	2.574	2.735	2.897	3.060	3.223	3.387	3.552	3.717	3.883	4.050	4.217
100	0.713	0.873	1.034	1.196	1.358	1.521	1.684	1.848	2.013	2.178	2.344	2.511	2.678	2.846	3.014	3.184	3.354	3.524	3.695	3.867	4.039	4.212	4.386
102	0.742	0.909	1.076	1.244	1.412	1.582	1.751	1.922	2.093	2.265	2.438	2.611	2.784	2.959	3.134	3.310	3.486	3.663	3.841	4.019	4.199	4.378	4.559
104	0.771	0.944	1.118	1.293	1.468	1.644	1.820	1.997	2.175	2.354	2.533	2.712	2.893	3.074	3.256	3.438	3.622	3.805	3.990	4.175	4.361	4.547	4.735
106	0.801	0.981	1.161	1.343	1.524	1.707	1.890	2.074	2.259	2.444	2.630	2.816	3.004	3.191	3.380	3.569	3.759	3.950	4.142	4.334	4.526	4.720	4.914
108	0.831	1.018	1.205	1.393	1.582	1.771	1.961	2.152	2.344	2.536	2.728	2.922	3.116	3.311	3.507	3.703	3.900	4.098	4.296	4.495	4.695	4.895	5.096
110	0.862	1.056	1.250	1.445	1.641	1.837	2.034	2.232	2.430	2.629	2.829	3.030	3.231	3.433	3.635	3.839	4.043	4.248	4.453	4.659	4.866	5.074	5.282
112	0.894	1.094	1.296	1.498	1.700	1.904	2.108	2.313	2.518	2.725	2.932	3.139	3.348	3.557	3.767	3.977	4.189	4.401	4.613	4.827	5.041	5.256	5.472
114	0.926	1.134	1.342	1.551	1.761	1.972	2.183	2.395	2.608	2.822	3.036	3.251	3.467	3.683	3.900	4.118	4.337	4.556	4.776	4.997	5.219	5.441	5.664

**Table 4: Log Volume in Cubic Metres of Tapering Cylinders** 

DIAMETER (small end)		LENGTH IN METRES																				
cm	5.5	5.7	5.9	6.1	6.3	6.5	6.7	6.9	7.1	7.3	7.5	7.7	7.9	8.1	8.3	8.5	8.7	8.9	9.1	9.3	9.5	9.7
4	0.020	0.021	0.022	0.024	0.025	0.027	0.028	0.030	0.032	0.034	0.035	0.037	0.039	0.041	0.043	0.045	0.048	0.050	0.052	0.055	0.057	0.060
6	0.033	0.035	0.037	0.039	0.041	0.044	0.046	0.048	0.051	0.053	0.056	0.059	0.061	0.064	0.067	0.070	0.073	0.076	0.080	0.083	0.086	0.090
8	0.050	0.053	0.056	0.058	0.062	0.065	0.068	0.071	0.074	0.078	0.081	0.085	0.089	0.092	0.096	0.100	0.104	0.108	0.113	0.117	0.121	0.126
10	0.070	0.074	0.078	0.082	0.086	0.090	0.094	0.098	0.102	0.107	0.111	0.116	0.121	0.126	0.131	0.136	0.141	0.146	0.151	0.157	0.162	0.168
12	0.094	0.090	0.104	0.109	0.114	0.119	0.124	0.129	0.135	0.140	0.146	0.152	0.158	0.164	0.170	0.176	0.183	0.189	0.196	0.202	0.209	0.216
14	0.121	0.127	0.133	0.139	0.146	0.152	0.158	0.165	0.172	0.179	0.186	0.193	0.200	0.207	0.215	0.222	0.230	0.238	0.246	0.254	0.262	0.271
16	0.152	0.159	0.166	0.174	0.181	0.189	0.197	0.205	0.213	0.221	0.230	0.238	0.247	0.256	0.265	0.274	0.283	0.292	0.302	0.311	0.321	0.331
18	0.186	0.195	0.203	0.212	0.221	0.231	0.240	0.249	0.259	0.269	0.279	0.289	0.299	0.309	0.320	0.330	0.341	0.352	0.363	0.375	0.386	0.398
20	0.224	0.234	0.244	0.255	0.265	0.276	0.287	0.298	0.309	0.321	0.332	0.344	0.356	0.368	0.380	0.393	0.405	0.418	0.431	0.444	0.457	0.470
22	0.265	0.276	0.288	0.301	0.313	0.325	0.338	0.351	0.364	0.377	0.391	0.404	0.418	0.432	0.446	0.460	0.474	0.489	0.504	0.519	0.534	0.549
24	0.309	0.323	0.337	0.351	0.365	0.379	0.394	0.408	0.423	0.438	0.454	0.469	0.485	0.501	0.517	0.533	0.549	0.566	0.583	0.600	0.617	0.634
26	0.357	0.373	0.388	0.404	0.420	0.437	0.453	0.470	0.487	0.504	0.521	0.539	0.557	0.574	0.593	0.611	0.629	0.648	0.667	0.686	0.706	0.725
28	0.408	0.426	0.444	0.462	0.480	0.499	0.517	0.536	0.555	0.574	0.594	0.613	0.633	0.653	0.674	0.694	0.715	0.736	0.757	0.779	0.800	0.822
30	0.463	0.483	0.503	0.523	0.544	0.564	0.585	0.606	0.628	0.649	0.671	0.693	0.715	0.738	0.760	0.783	0.806	0.830	0.853	0.877	0.901	0.925
32	0.522	0.544	0.566	0.589	0.611	0.634	0.658	0.681	0.705	0.729	0.753	0.777	0.802	0.827	0.852	0.877	0.903	0.929	0.955	0.981	1.008	1.035
34	0.583	0.608	0.633	0.658	0.683	0.708	0.734	0.760	0.786	0.813	0.839	0.866	0.894	0.921	0.949	0.977	1.005	1.033	1.062	1.091	1.120	1.150
36	0.649	0.676	0.703	0.731	0.758	0.786	0.815	0.843	0.872	0.901	0.931	0.960	0.990	1.020	1.051	1.082	1.112	1.144	1.175	1.207	1.239	1.271
38	0.717	0.747	0.777	0.807	0.838	0.869	0.900	0.931	0.963	0.995	1.027	1.059	1.090	1.125	1.158	1.192	1.226	1.260	1.294	1.329	1.364	1.399
40	0.789	0.822	0.855	0.888	0.921	0.955	0.989	1.023	1.058	1.092	1.127	1.163	1.198	1.234	1.271	1.307	1.344	1.381	1.418	1.456	1.494	1.532
42	0.865	0.901	0.936	0.972	1.009	1.045	1.082	1.119	1.157	1.195	1.233	1.271	1.310	1.349	1.388	1.428	1.468	1.508	1.549	1.590	1.631	1.672
44	0.944	0.983	1.021	1.061	1.100	1.140	1.180	1.220	1.261	1.302	1.343	1.385	1.427	1.469	1.511	1.554	1.597	1.641	1.685	1.729	1.773	1.818
46	1.027	1.068	1.110	1.153	1.195	1.238	1.282	1.325	1.369	1.413	1.458	1.503	1.548	1.594	1.639	1.686	1.732	1.779	1.826	1.874	1.922	1.970
48	1.113	1.158	1.203	1.249	1.295	1.341	1.388	1.435	1.482	1.530	1.578	1.626	1.675	1.724	1.773	1.823	1.873	1.923	1.974	2.025	2.076	2.128
50	1.202	1.250	1.299	1.348	1.398	1.448	1.498	1.548	1.599	1.650	1.702	1.754	1.806	1.859	1.911	1.965	2.018	2.072	2.127	2.181	2.237	2.292
52	1.295	1.347	1.399	1.452	1.505	1.558	1.612	1.666	1.721	1.776	1.831	1.886	1.942	1.999	2.055	2.112	2.170	2.227	2.286	2.344	2.403	2.462
54	1.391	1.447	1.503	1.559	1.616	1.673	1.731	1.789	1.847	1.906	1.965	2.024	2.084	2.144	2.204	2.265	2.326	2.388	2.450	2.513	2.575	2.638
56	1.491	1.550	1.610	1.671	1.731	1.792	1.854	1.915	1.977	2.040	2.103	2.166	2.230	2.294	2.359	2.423	2.489	2.554	2.620	2.687	2.754	2.821
58	1.594	1.658	1.721	1.786	1.850	1.915	1.981	2.046	2.113	2.179	2.246	2.313	2.381	2.449	2.518	2.587	2.656	2.726	2.796	2.867	2.938	3.009
60	1.701	1.768	1.836	1.905	1.973	2.042	2.112	2.182	2.252	2.323	2.394	2.465	2.537	2.610	2.683	2.756	2.829	2.904	2.978	3.053	3.128	3.204
62	1.811	1.883	1.955	2.027	2.100	2.174	2.247	2.321	2.396	2.471	2.546	2.622	2.699	2.775	2.853	2.930	3.008	3.087	3.165	3.245	3.324	3.405
64 66	1.925 2.042	2.001	2.077	2.154	2.231	2.309	2.387	2.465 2.614	2.544	2.624	2.704 2.866	2.784	2.865 3.036	2.946 3.122	3.028 3.208	3.110 3.295	3.192 3.382	3.275	3.358	3.442	3.527 3.735	3.611 3.824
68	2.042	2.122	2.203	2.284	2.505	2.448	2.531	2.767	2.855	2.781	3.032	3.122	3.036	3.122	3.208	3.485	3.382	3.469 3.669	3.557 3.762	3.646 3.855	3.735	4.043
70	2.162	2.247	2.333	2.419	2.648	2.592	2.831	2.767	3.017	3.110	3.204	3.122	3.393	3.488	3.584	3.680	3.777	3.874	3.762	4.070	4.169	4.043
70 72	2.286	2.508	2.466	2.557	2.648	2.739	2.831	3.085	3.183	3.110	3.204	3.479	3.579	3.488	3.584	3.881	3.777	4.085	4.188	4.070	4.169	4.268
74	2.414	2.644	2.744	2.844	2.794	3.046	3.148	3.251	3.354	3.457	3.561	3.479	3.770	3.875	3.780	4.088	4.195	4.302	4.410	4.291	4.627	4.499
76	2.679	2.783	2.888	2.994	3.100	3.206	3.313	3.421	3.529	3.637	3.746	3.856	3.966	4.077	4.188	4.299	4.195	4.524	4.637	4.751	4.865	4.737
78	2.817	2.783	3.037	3.147	3.258	3.206	3.482	3.595	3.708	3.822	3.746	4.052	4.167	4.077	4.188	4.299	4.634	4.752	4.870	4.751	5.109	5.229
80	2.958	3.073	3.188	3.304	3.421	3.538	3.462	3.774	3.893	4.012	4.132	4.052	4.167	4.283	4.616	4.739	4.862	4.752	5.109	5.234	5.359	5.485
82	3.103	3.233	3.344	3.466	3.588	3.710	3.833	3.957	4.081	4.206	4.331	4.457	4.584	4.711	4.838	4.739	5.095	5.224	5.454	5.484	5.615	5.746
84	3.251	3.377	3.503	3.630	3.758	3.886	4.015	4.144	4.274	4.405	4.536	4.667	4.799	4.932	5.065	5.199	5.334	5.469	5.604	5.740	5.877	6.014

**Table 4: Log Volume in Cubic Metres of Tapering Cylinders** 

DIAMETER (small end)											LENG	TH IN M	ETRES									
cm	5.5	5.7	5.9	6.1	6.3	6.5	6.7	6.9	7.1	7.3	7.5	7.7	7.9	8.1	8.3	8.5	8.7	8.9	9.1	9.3	9.5	9.7
86	3.402	3.534	3.666	3.799	3.933	4.066	4.201	4.336	4.472	4.608	4.745	4.882	5.020	5.159	5.298	5.438	5.578	5.719	5.860	6.002	6.145	6.288
88	3.558	3.695	3.833	3.972	4.111	4.251	4.391	4.532	4.674	4.816	4.959	5.102	5.246	5.390	5.536	5.681	5.828	5.974	6.122	6.270	6.419	6.568
90	3.716	3.859	4.004	4.148	4.293	4.439	4.586	4.733	4.800	5.028	5.177	5.327	5.477	5.627	5.778	5.930	6.083	6.236	6.389	6.544	6.698	6.854
92	3.878	4.028	4.178	4.328	4.480	4.632	4.784	4.937	5.091	5.245	5.400	5.556	5.712	5.869	6.027	6.185	6.343	6.503	6.662	6.823	6.984	7.146
94	4.043	4.199	4.355	4.512	4.670	4.828	4.987	5.146	5.306	5.467	5.628	5.790	5.953	6.116	6.280	6.444	6.609	6.775	6.941	7.108	7.276	7.444
96	4.212	4.374	4.537	4.700	4.864	5.029	5.194	5.360	5.526	5.693	5.861	6.029	6.198	6.368	6.538	6.709	6.881	7.053	7.226	7.399	7.574	7.748
98	4.385	4.553	4.722	4.892	5.062	5.234	5.405	5.578	5.751	5.924	6.098	6.273	6.449	6.625	6.802	6.980	7.158	7.337	7.516	7.696	7.877	8.059
100	4.561	4.736	4.911	5.088	5.265	5.442	5.621	5.800	5.979	6.160	6.341	6.522	6.704	6.887	7.071	7.255	7.440	7.626	7.812	7.999	8.187	8.375
102	4.740	4.922	5.104	5.287	5.471	5.655	5.840	6.026	6.212	6.400	6.587	6.776	6.965	7.155	7.345	7.536	7.728	7.921	8.114	8.303	8.503	8.698
104	4.923	5.111	5.300	5.490	5.681	5.872	6.064	6.257	6.450	6.644	6.839	7.034	7.230	7.427	7.625	7.823	8.022	8.221	8.422	8.622	8.824	9.026
106	5.109	5.304	5.500	5.697	5.895	6.093	6.292	6.492	6.692	6.893	7.095	7.298	7.501	7.705	7.909	8.115	8.321	8.527	8.735	8.943	9.152	9.361
108	5.298	5.501	5.704	5.908	6.113	6.318	6.524	6.731	6.939	7.147	7.356	7.566	7.776	7.987	8.199	8.412	8.625	8.839	9.054	9.269	9.485	9.702
110	5.491	5.701	5.912	6.123	6.335	6.548	6.761	6.975	7.190	7.405	7.622	7.839	8.056	8.275	8.494	8.714	8.935	9.156	9.378	9.601	9.825	10.049
112	5.688	5.905	6.123	6.342	6.561	6.781	7.002	7.223	7.445	7.668	7.892	8.117	8.342	8.568	8.794	9.022	9.250	9.479	9.709	9.939	10.170	10.402
114	5.888	6.113	6.338	6.564	6.791	7.018	7.247	7.476	7.705	7.936	8.167	8.399	8.632	8.866	9.100	9.335	9.571	9.807	10.045	10.283	10.522	10.761

## **Table 5** Factors for Metric Conversion

# **Stacked Wood Conversion**

One cubic metre (m³) = one cubic metre of solid wood One stacked cubic metre [m³ (stacked)] = a properly piled stack of wood

1 m x 1 m x 1 m

 $1 \text{ m}^3 = 1.51 \text{ m}^3 \text{ (stacked)}$ 

 $1 \text{ m}^3 = 1.28 \text{ m}^3 \text{ (stacked) peeled}$ 

1 m<sup>3</sup> (stacked) =  $0.664 \text{ m}^3$ 1 m<sup>3</sup> (stacked) peeled =  $0.781 \text{ m}^3$ 

One stacked cubic metre is approximately: 66% Wood

12% Bark 22% Airspace

#### **APPENDICES**

#### Appendix 1

#### **Log Identification**

#### **Definitions**

**Bark** – The outer portion is dry, hard, and forms many patterns. The inner portion is soft, and usually lighter in colour.

**Wood** – It consists of heartwood and sapwood. The sapwood surrounds the heartwood and is usually lighter in colour.

**Rays** – A pattern that shows on the end of some logs. It appears as fine lines that look like the spokes of a wheel.

**Annual Ring** – The end of a log shows concentric rings. Each ring represents the annual growth of spring and summer wood. The spring wood is the inner portion of the annual ring. The summer wood is the outer portion and is a darker colour.

**Ring Porous** – These are open grained woods. They have large openings or pores in the spring wood, easily detected by the eye.

**Diffuse Porous** – These are close grained woods. The pores are too small to be seen easily.

#### **Hardwoods**

Hardwoods that have diffuse porous wood with rays that are not visible include birch, basswood, aspen and poplar.

**Birch** – Heartwood, usually regular in outline and light to reddish brown with milky circles. Yellow birch has yellowish bark in thin layers of curly or flat flakes. White birch has creamy white bark in thin paper-like layers.

**Basswood** – This wood is very soft. The outer bark has flat-topped ridges on large logs, and is smooth on small logs. The inner bark is fibrous and usually separated from the wood. The line between wood and bark is scalloped. The heartwood is not easily recognized, and may be slightly stained and diseased.

**Trembling Aspen** – This wood is moderately light, soft, and relatively low in strength. The outer bark is smooth with a waxy appearance and pale green to almost white. With age, it becomes grey, breaking up into hard, flat topped ridges that are separated by shallow fissures. The interior bark does not separate from the wood.

The heartwood is hard to determine and may be slightly stained and diseased.

**Balsam Poplar** – This wood is light, soft and low in strength. The heartwood is greyish brown and the sapwood is nearly white. The bark of young trees is smooth, greenish-brown,. It turns dark greyish and becomes furrowed in flat topped rough ridges separated by irregular V-shaped crevices.

Hardwoods that have ring porous wood with rays that are not visible include black ash and white elm.

**Black Ash** – This wood has a soft thin layer of grey, scaly or slightly ridged outer bark, with a thick layer of inner bark. The heartwood is brownish, and the sapwood is a narrow layer of greyish white. The annual ring is a wide layer of open-grained wood and a narrow layer of close grained wood. The wood is dull in appearance.

White Elm – This wood has outer bark with firm rounded ridges, the cross section of which shows dark brown and light layers. The heartwood is easily determined with a thick layer of sapwood. The annual ring shows a narrow layer of open-grained wood consisting of one line of large openings. The wood is close grained and shows white wavy lines.

#### Softwoods

Softwoods that have gum in the wood and easily determined heartwood include pine and larch.

**Jack Pine** – This wood has small beads of gum in the heartwood and sapwood. The bark is scaly and brownish under the scales. The heartwood is a brownish colour and there is a trough-like depression above and below knots.

**Larch** (**Tamarack**) – This wood has small beads of gum in the heartwood and sapwood. The bark is reddish brown and purple under the scales. The annual rings are very distinct and the heartwood is dark in colour, so there is a distinct contrast between the sapwood and heartwood.

Softwoods that have gum in the wood but heartwood is hard to determine include spruce.

**Spruce** – This wood has small beads of gum in the sapwood **only. The** gum dries up, leaving a rough sandpaper-like surface. White spruce is silvery pink under the scales. Black spruce is olive green under the scales

Softwoods that have gum in the bark include balsam and cedar.

**Balsam Fir** – This wood has liquid-like gum contained in blisters in young, smooth bark. In the older, ridged bark, the gum is crystallized. The heartwood is hard to determine.

**Cedar** – This wood has amber-coloured beads of gum that appear in the inner bark. The outer bark is broken up into narrow, fibrous ridges and the heartwood is easily determined and often defective.

Appendix 2
Principal Commercial Species: Identification and Symbols

Species	Scientific Name	Symbol	Description
White Spruce	Picea glauca	WS	Salmon pink inner bark
Black Spruce	Picea mariana	BS	Olive coloured inner bark
Balsam Fir	Abies balsamea	BF	Smooth distinctive bark, pitch pockets, odour
Jack Pine	Pinus banksiana	JP	More distinctive growth rings than spruce
Tamarack (Eastern Larch)	Larix laricina	TL	Chocolate hued heartwood, bright purple inner bark
Cedar (Eastern White Cedar)	Thuja occidentalis	EC	Thin, shredded bark with narrow elongated fibrous strips, reddish to pale brown heartwood
Trembling Aspen	Populus tremuloides	TA	On cut face, fuzzy (White Poplar) texture of wood surface, tends to have many stains or decay pockets
Balsam Poplar (Black Poplar)	Populus balsamifera	BA	Tendency to ring shake, dark coloured heartwood and deeply cut bark
Birch (White Birch)	Betula papyrifera	WB	White sapwood, brown heart and wood much harder than the other species

# Appendix 3

## **Summary of Formulae**

#### Smalian's formula

In symbol form Smalian's formula is:

$$V = \frac{A_s + A_l}{2} \times L$$

Where:

A<sub>s</sub> = 
$$\pi \left( \frac{ds}{2 \times 100} \right)^2$$
 = area of the small end of the log

A<sub>I</sub> = 
$$\pi \left( \frac{dl}{2 \times 100} \right)^2$$
 = area of the large end of the log

 $V = \log \text{ volume in cubic metres}$ 

A = area of log end in square metres

ds = diameter of small end in centimetres

dl = diameter of large end in centimetres

L =length of log in metres

 $\pi = 3.14159$ 

### Volume in cubic metres of timber or defects

$$\frac{D^2 \times 0.7854 \times L}{10,000} = \text{cubic metres correct to three decimal places}$$

Where: D = diameter of log or defect in 2 centimetre classes

L =length of log or defect in metres and 2 centimetre classes

## Volume in stacked cubic metres rough for individual logs or defects

$$\frac{D^2 \times 0.7854 \times L}{10,000} = \text{metres cubed correct to 3 decimals x 1.51= stacked cubic metres correct to}$$
 two decimal places

Where: 
$$D = \text{diameter of log or defect in 2 centimetre classes}$$

$$L =$$
length of log (or width of pile) or defect in metres and 2 centimetre classes

### Volume in stacked cubic metres peeled for individual logs or defects

$$\frac{D^2 \times 0.7854 \times L}{10,000} = \text{metres cubed correct to 3 decimals x 1.28} = \text{stacked cubic metres correct to}$$
 two decimal places

Where: 
$$D = \text{diameter of log or defect in 2 centimetre classes}$$

$$L =$$
length of log (or width of pile) or defect in metres and 2 centimetre classes

#### Volume in stacked cubic metres

 $H \times L \times W =$  stacked cubic metres correct to two decimal places

Where: 
$$H = \text{height of stack in metres and 2 centimetre classes}$$

L =length of stack in metres (2 decimal places)

W = width of stack (length of bolt) in metres and 2 centimetre classes

### **Appendix 4** Answers to Exercises

## **Principles of Rounding Exercise** – from page 8

8.377 = 8.38

8.374 = 8.37

8.375 = 8.38

8.365 = 8.36

2.436 = 2.44

2.479 = 2.48

2.123 = 2.12

2.315 = 2.32

5.225 = 5.22

5.528 = 5.53

5.235 = 5.24

5.155 = 5.16

#### **Diameter Averaging Exercise** – from page 12

Measurements	Average	Recorded as
44 + 46	45	44
24 + 28	26	26
34 + 40	37	36

#### **Cubic Method Two Exercise** – from page 15

Log #	Length	Dia. 1	Area 1	Dia. 2	Area 2	Volume m <sup>3</sup> $\frac{Area\ 1 + Area\ 2}{2}  X \text{ length}$
1	2.54	28	.0616	30	.0707	$(.0616 + .0707) / 2 \times 2.54 = .168$
2	2.44	20	.0314	16	.0201	$(.0314 + .0201) / 2 \times 2.44 = .063$
3	2.56	16	.0201	18	.0254	$(.0201 + .0254) / 2 \times 2.56 = .058$

#### **Defect Deductions Exercise** – from page 43

		1 0			
Log length	Small end diameter	Gross Volume m <sup>3</sup> (table 4)	Defect	Defect Volume m <sup>3</sup>	Net Volume m <sup>3</sup>
3.7 m	34 cm	.373	BL 16 cm	.022/2 = .011	.362
4.9 m	42 cm	.760	BL 12 cm	.012/2 = .006	.754
5.1 m	36 cm	.595	HL 20 cm	.160/2 = .080	.515

# Appendix 5 Manitoba Natural Resources and Northern Development Scaling Plan

		S( April 1, 20	CALING March 3		M	anito	ba 🦬
Name of Cu	itting Right Holder:				ì	0	Original
Address:		Email:				0	Amendment
THIS SCALIN	NG PLAN IS FOR TIMBI	ER CUT UNDER TH	E FOLLOWIN	G AUTHORITY:		-	Replace Original
Timber Sale	# or Timber Permit C	luota#:			,		
The timber	will be delivered to t	he locations iden	tified below:	and scaled using	the method:	s indicated	below:
Source/ Location (Cut block #, indicate if On- Hand Wood)	Final  Destination  (Mill/facility name & town, rail siding, approved stockpile arc.)	Commodity/ Product (es. Karlt, Newsprint, DSE, SWL, HAVL, Blamess, Fuelwood, Post & Reils)	Estimated Volume (m²)	Species lenter appropriate species or species combination-see abbreviations in Instructions)	Scaling Method (use codes, see bolow)	Scaling Location (use codes, see below)	Licenced Scaler Licence # (Not required for weigh scale operations)
		Total	10		1 - Mess of Roundergod b) CNos 2 - Solid 4 - Price (Trees	) - 50H Gate 2 - In Utah 3 - Stockpile 4 - Other	
be adhered to	N CONDITIONS: All provi	DECLARE THAT T	HE ABOVE NEG	OR MATION IS CORF	on as well as th	SE TO THE CO	
Cutting Fight Ho	older or Designate Signature	22	Date		€		
Forestry Office	78	8	Forestry Signatur	re		Date	
2022 04 84				Copy Distribution.	O iginal - Sale or 2nd COPY - Regio 3rd COPY - Winn	m/District	

# Appendix 6 Manitoba Natural Resources and Northern Development Crown Land Load Slip

FAILURE TO PROPERLY COMPLETE THIS FORM M	MAY RESULT IN PROS	SECUTION	50	6331 01
Seller / Shipper		R	eceiver / Purch	aser
1. NAME:	2. NAME:			
ADDRESS:		ADDRESS:		
3. AUTHORITY This timber was cut to (a) Timber Sale/Permit/Licence No  (b) Cut Block No  4. Certified Correct:	. Contract No	iota No		it No.
Signature of	f Timber Cutting Rig	ht Holder		
		ARRIER DATA		
5. SPECIES Spruce, Pine, Birch, Poplar, etc.		PRODUCT gth, 16', 8', Chips, etc.	6. ESTIMA m³, to	TED QUANTITY ones, kgs, pieces, etc.
b)				
c) 7. Loading Point:	8.	Delivery Location	on:	spile Mill
7. Loading Point:    Bush   Stockpile   St	Tr	railer Licence #:  Load Slip contains		□ am □ pm
7. Loading Point:  9. Date Loaded:  10. Truck # / Licence #:  This will certify that the load of timbe  11. Certified Correct:  Sign	Treer covered by this	railer Licence #:  Load Slip contains  Date of the contains	by measurement, or	□ am □ pm
7. Loading Point:    Bush   Stockpile   St	Treer covered by this nature of Truck Open	railer Licence #:  Load Slip contains  Director  Load Slip and subm	by measurement, or ate:	best estimate.
7. Loading Point:    Bush   Stockpile   St	Treer covered by this  nature of Truck Open  WHITE copy of one - Seller/operate	railer Licence #:  Load Slip contains  parator  Load Slip and submor must retain WH.	by measurement, or ate:	best estimate.  ch monthly.  with Timber Return
7. Loading Point:    Bush   Stockpile   St	Treer covered by this  nature of Truck Open  WHITE copy of one - Seller/operate	railer Licence #:  Load Slip contains  parator  Load Slip and submor must retain WH.	by measurement, or ate:	best estimate.  ch monthly.  with Timber Return
7. Loading Point:    Bush   Stockpile   Point   Point   Stockpile   Point   Po	Treer covered by this  nature of Truck Open  WHITE copy of one - Seller/operate, Birch, Poplar Etc.  d, Chips, Etc.	railer Licence #: Load Slip contains  Dirator  Load Slip and submor must retain WH.  13.	by measurement, or ate:	best estimate.  ch monthly.  with Timber Return  EIVED  Tomnes, Etc.

# Appendix 7 Manitoba Natural Resources and Northern Development Private Land Load Slip

AILURE TO PROPERLY COMPLETE THIS FORM MAY RESULT IN PRO		D : /P 1
Seller / Shipper  1. NAME:	2. NAME:	Receiver / Purchaser
ADDRESS:	ADDRESS	•
AUTHORITY This timber was cut/purchased under     (a) Timber Dealers Licence No	er the authority of:	
(b) Wood Processing Facility Licence No.		
(c) Private Land Owned by:		
1/4 Sec Twp	Rae W/FPM	
2000 National 200 No. ■	_ Rgc W/E/ W	
4. Certified Correct:		Date
The state of the s	/ CARRIER DAT	TA .
<ol> <li>SPECIES/PRODUCT Spruce, Pine, Birch, Poplar, Etc. Sawlogs, Lumber, Pulp, Posts, Fuelwood, Chips, Etc.</li> </ol>	6.	ESTIMATED QUANTITY
7. Loading Point:    Bush   Stockpile   Mill   Stoc	Trailer Licence #	#: □ am □ pm
7. Loading Point:  Bush Stockpile Mill  9. Date Loaded:	Time Loaded: Trailer Licence # his Load Slip contains b	tion: Stockpile
7. Loading Point:    Bush   Stockpile   Mill   Mill   Stockpile   Mill   Stockpile   Mill   Mill   Stockpile   Mill   Mil	Time Loaded: Trailer Licence # his Load Slip contains b Operator  EIVER DATA	tion:   Stockpile   Mill   am   pm
7. Loading Point:  Bush Stockpile Mill  9. Date Loaded:  10. Truck # / Licence #:  This will certify that the load of timber covered by th  11. Certified Correct:  Signature of Truck (	Time Loaded: Trailer Licence # his Load Slip contains b Operator  EIVER DATA	tion:   Stockpile   Mill   am   pm
7. Loading Point:    Bush	Time Loaded:	tion: stockpile

# Appendix 8 Application for Scaler's Licence in Manitoba

Please complete application and return to: Natural Resources and Northern Development Forestry and Peatlands Branch 14 Fultz Blvd, Box 70 Winnipeg, MB, R3Y 0L6



#### APPLICATION FOR SCALER'S LICENCE IN MANITOBA

Name:
Address:
City/Town: Postal Code:
Phone: e-mail:
Have you ever <u>held</u> or <u>applied</u> for a scaler's licence in the Province of Manitoba? YES NO If yes, please state details
Have you ever taken a Manitoba Scaling course? YES NO If yes, what year?
Please state any previous scaling experience you may have
OUT OF PROVINCE SCALER'S:
Do you presently hold a <u>valid</u> scaler's licence from another Province? YES NO
Issuing ProvinceYear Issued Expiry Date
Licence confirmed in good standing
FOR DEPARTMENT USE ONLY
Date Received Date Approved
Signing Authority
Code: 2.16

# Appendix 9 Mass/Volume Sampling Tally Sheet

	MASS CONVERSION SAMPLING							TL or Cut to	Length
	Species	End "A" Diameter (2 cm class)	End "B" Diameter (2 cm class)	Total Length (m, to 2cm class)		Species	End "A" Diameter (2 om class)	End "B" Diameter (2 on class)	Total Length (m, to 2cm class)
1					1				
2					2				
3					3				
4					4				
5					5				
6					6				
7					7				
8					8				
9					9				
0					0				
1					1				
2					2				
3					3				
4					4				
5					5				
6					6				
7					7				
8					8				
9					9				
0					0				
1					1				
2					2				
3					3				
4					4				
5					5				
6					6				
7					7				
8					8				
9					9				
0					0				
_									

$\overline{}$	$\overline{}$
1	-/

Location:

Comments:

Scalers:

Page:\_\_\_\_\_ of \_\_\_\_\_

Date:

Sample Weight:

#### **Appendix 10 Undersize and Defect Sampling Procedures**

## Provincial Roundwood Undersize & Defect Measurement Procedures

#### **Equipment**

Tally sheets/clipboard/pencils Blue Lumber crayon Scaling Stick (MC-1 or MC-2)

2 x 1 metre rectangle Tape measure

#### **Objective**

To sample roundwood and verify undersize and defect percentages that are in place for a number of Mill Facilities (ex CKPI & LP) in Manitoba. To meet objectives identified in Regional Scaling Work Plans.

#### **Procedure**

Slashed roundwood in a mill yard, stockpile site or in-block can be sampled for undersize and defect, as per the Regional Scaling Work Plan. Sampling is optimized with two people participating, a tally person and a measurement person. One person must have a valid Manitoba Scalers' Licence.

The Scalers' are presented with a row of slashed roundwood, the Scalers start at one end of the pile and work their way towards the opposite end. Log lengths are generally 2.5 or 5.1 metres.

The 2 x 1 metre rectangle is placed on the roundwood pile; diameters are measured and tallied, followed by defect measurements.

- 1. For small diameter timber, measure logs that are completely within the rectangle. Any logs that have the rectangle over any portion of the log are not tallied.
- 2. For large diameter timber (>25 cm), measure logs that are within the rectangle and measure logs that the rectangle overlaps.

Twenty-five repetitions are suggested as a sample field day for two people. The rectangle is moved across the face of the log pile, so as to capture distinct samples (no overlap).

#### **Health & Safety**

Notify the mill/loader operator that you are entering the site. Care must be taken that the rectangle is hung securely to the log pile, that the rectangle does not fall off the pile and injure the Scalers. Care must also be taken in being observant to operators and equipment that may be active in the mill/stockpile or cut block site. Hard hat and high visibility clothing is required. Additional PPE may be required by the mill site. Ensure proper footing while scaling and do not crawl up piles of stacked timber.

<sup>\*</sup>Diameters are taken to the 2cm (even) class.

<sup>\*</sup>Ensure timber was harvested in Manitoba.

#### UNDERSIZE AND DEFECT FACTOR SAMPLING

	Number		Defect	Cull		Nun	nber	Defect	Cull
6					6				
8					8				
10					10				
12					12				
14					14				
16					16				
18					18				
20					20				
22					22				
24					24				
26					26				
28					28				
30					30				
32					32				
34					34				
36					36				
38					38				
40					40				
42					42				
44					44				
46					46				
48					48				
50					50				
	Tally of Samples					Tally of Samples			

Cd um 1	Date	Cd um 2
Number of Samples:	Locati ort	Number of Samples:
Log Length	Scaler(s)	Log Lengt h
Speci es:	Comment s	Species:
		Pageof

#### **Appendix 11 Chipperwood Sampling Procedures**

### Provincial Chipperwood Measurement Procedures

#### **Equipment**

Metric logger's tape

2 metric carpenter tape measures

2 calipers (9.1 cm and 5.1 cm)

Tally sheets/clipboard/pencil
Blue lumber crayon

MC-1 scaling stick

#### **Objective**

To sample chipperwood and verify undersize percentages for a number of mill facilities (ex CKPI & SPL) in Manitoba. To meet sampling objectives for total chipperwood measurements and distribution throughout FMU's, within cut blocks and throughout operating seasons as established in Regional Scaling Work Plans.

#### **Procedure**

In areas with active operations, Operators maybe asked to spread a sample of a pile (tree length, tops, or cut to length) on the ground for ease of measurement. When operations are inactive, at time of measurements, the ends of piles are measured. The entire tree or piece of a tree must be accessible in order to obtain accurate measurements.

Sampling is most efficient with three people; one person must have a valid Manitoba Scalers Licence.

Large end, top diameters and lengths are recorded to the 2cm class (Ex. 20cm, 6cm, 2.52m etc.). All measured pieces are marked with a lumber crayon on the large end.

The person recording measurements determines the diameter at the large end of the tree, log, or piece. This person also sets the end of the logger's tape at the large end, while another person determines where the 9.1cm diameter exists. The 9.1cm caliper is moved from the base of the tree towards the top of the tree or piece until it falls into place. With the caliper in place, the length from the large end to the caliper is measured.

The 5.1cm caliper is moved from the 9.1cm diameter towards the top of the tree or piece until it falls into place. The length from the 9.1cm caliper to the 5.1cm diameter is recorded. If the top diameter of the tree or piece is between 5.1 and 9.1cm, the top diameter is measured and the length from the 9.1cm diameter to the top is recorded.

When a tree or piece is forked, measurements are taken from the large end to the 5.1cm or top of the dominant fork. The remaining fork or forks are then measured as a separate piece or pieces from where the forking begins to the 5.1cm or top.

Data is entered into an Excel spreadsheet which uses Smalian's formula to calculate merchantable (>9.1cm) and non-merchantable (<9.1 cm) volumes. The non-merchantable

factor is calculated by dividing the total non-merchantable volume by the total volume of chipperwood measured. Species is recorded for the sample as Spruce/Pine/Mix.

#### **Health & Safety**

Notify the mill/operators if working in the area. Care must be taken in working beside or on a log pile. Care must also be taken in being observant to operators and equipment that may be active in the cut block site. Hard hat and high visibility clothing is required. Additional PPE maybe required by mill/operators. Ensure proper footing while scaling and do not crawl up piles of timber.

CHIPPERWOOD SAMPLING

Type: TL or Length\_\_\_\_\_

	Large End Diameter (cm)	Large End Length (Butt to 9 cm)	Top Diameter (cm)	Total Length (m)			Large End Diameter (cm)	Large End Length (Butt to 9 cm)	Top Diameter (cm)	Total Length (m)
1						31				
2						32				
3						33				
4						34				
5						35				
6						36				
7						37				
8					L	38				
9					L	39				
10					L	40				
11					L	41				
12					L	42				
13					L	43				
14					L	44				
15					L	45				
16					L	46				
17					L	47				
18					L	48				
19					L	49				
20					L	50				
21					L	51				
22					L	52				
23					L	53				
24					L	54				
25					L	55				
26					L	56				
27					L	57				
28						58				
29						59				
30						60				

Date:	Location:	Scalers:	
Comments:		Page:	of

#### **Appendix 12 Post and Rail Sampling Procedures**

# Provincial Post and Rail Measurement Procedures

#### **Equipment**

Metric Logger's Tape 2 D-tapes or Measuring Tapes 3 Calipers (13.1 cm, 9.1 cm, & 5.1cm) Tally sheets/clipboard/pencil Blue lumber crayon

#### **Objective**

To sample post and rail logs, sampled by government scalers, to verify factors and undersize percentages for a number of mill facilities in Manitoba.

#### **Procedures**

Sampling is most efficient with three people; one person must have a valid Manitoba Scalers Licence. One person records as the other two measure the logs.

Call the mill ahead of time and ask for operators to spread samples of logs in the yard onto the ground. Logs may be tree length, or cut to a specific length. Make sure to identify the length on the tally sheet.

Diameters are rounded to the nearest centimetre (inside bark) and exact lengths are recorded. (ex. 5.00m, 5.23m, etc). All measured pieces are marked with a lumber crayon on the large end.

The two people measuring the logs will each have an end of the loggers tape and will place the logging tape on top of the log, running the length of the log. The person at the butt end of the log will use a D-tape or measuring tape to measure the diameter of the butt. This measurement will be recorded in the first column of the tally sheet (Large End Diameter).

Using the 13.1cm caliper, determine where the log reaches 13.1cm in diameter, then measure the length from the **butt** of the log to where the 13.1cm caliper lands. Record that length in the second column (Large End Length).

Continue down the log with the 9.1cm caliper and determine where the log reaches a diameter of 9.1cm. Again, measure the length from the **butt** end to the 9.1cm caliper. Record that length in the third column (Middle Length).

The "Top Diameter" is the end of merchantable wood and will be 5.1cm or larger. To measure the "Top Diameter", use the 5cm caliper **OR** measure the diameter of the top end, using a D-tape or measuring tape, and record the **diameter** in the fourth column (Top Diameter).

When a tree or piece is forked, measurements are taken from the large end to the 5.1cm or top of the dominant fork. The remaining fork or forks are then measured as a separate piece or pieces from where the forking begins to the 5.1cm or top.

The last column is the Total Length and is the **length** of the log from the **butt** end to the "top diameter".

If your" Large End Diameter" is 13.1cm or less; there will be no "Large End Length" (butt to 13cm), leave that column blank and begin sampling the "Middle Length".

If your "Top Diameter" is between 9.1 and 13.1cm; there will be no "Middle Length" (13.1 to 9.1cm length), leave that column blank, record the "Top Diameter" and record the "Total Length" from the butt to the end of the log.

#### Examples:

Large End Diameter (cm)	Large End Length (Butt to 13cm)	Middle Length (13cm to 9cm)	Top Diameter (cm)	Total Length (m)
17	1.43	4.72	5	9.61
12		9.95	5	8.55
19	4.70		10	7.23

#### **Health & Safety**

Notify the mill/operators when working in the area. Care must also be taken in being observant to operators and equipment that may be active in mill site. Hard hat and high visibility clothing is required. Mills may require additional PPE to be worn.

POST AND RAIL SAMPLING

Type: TL or Length\_\_\_\_\_

Large End Diameter (cm)	Large End Length (Butt to 13 cm)	Middle Length (13 cm to 9 cm)	Top Diameter (cm)	Total Length (m)	Large End Diameter (cm)	Large End Length (Butt to 13 cm)	Middle Length (13 cm to 9 cm)	Top Diameter (cm)	Total Length (m)
1					31				
2					32				
3					33				
4					34				
5					35				
6					36				
7					37				
8					38				
9					39				
10					40				
11					41				
12					42				
13					43				
14					44				
15					45				
16					46				
17					47				
18					48				
19					49				
20					50				
21					51				
22					52				
23					53				
24					54				
25					55				
26					56				
27					57				
28					58				
29					59				
30					60				

Date:	Location:	Scalers:
Comments:		Page: of